

13 - 15mm min


13 - 15mm min

GOLD LABELED SIDE


BOARD

FRAMING



Densglass boards to butt together



FOR FIXING INTO METAL FRAMING
RCM FIX018 SCREW Ø4.2mm x 32mm
& Benx approved equivalent



FOR FIXING INTO TIMBER FRAMING
RCM FIX005 SCREW Ø4.2mm x 42mm
& Benx approved equivalent

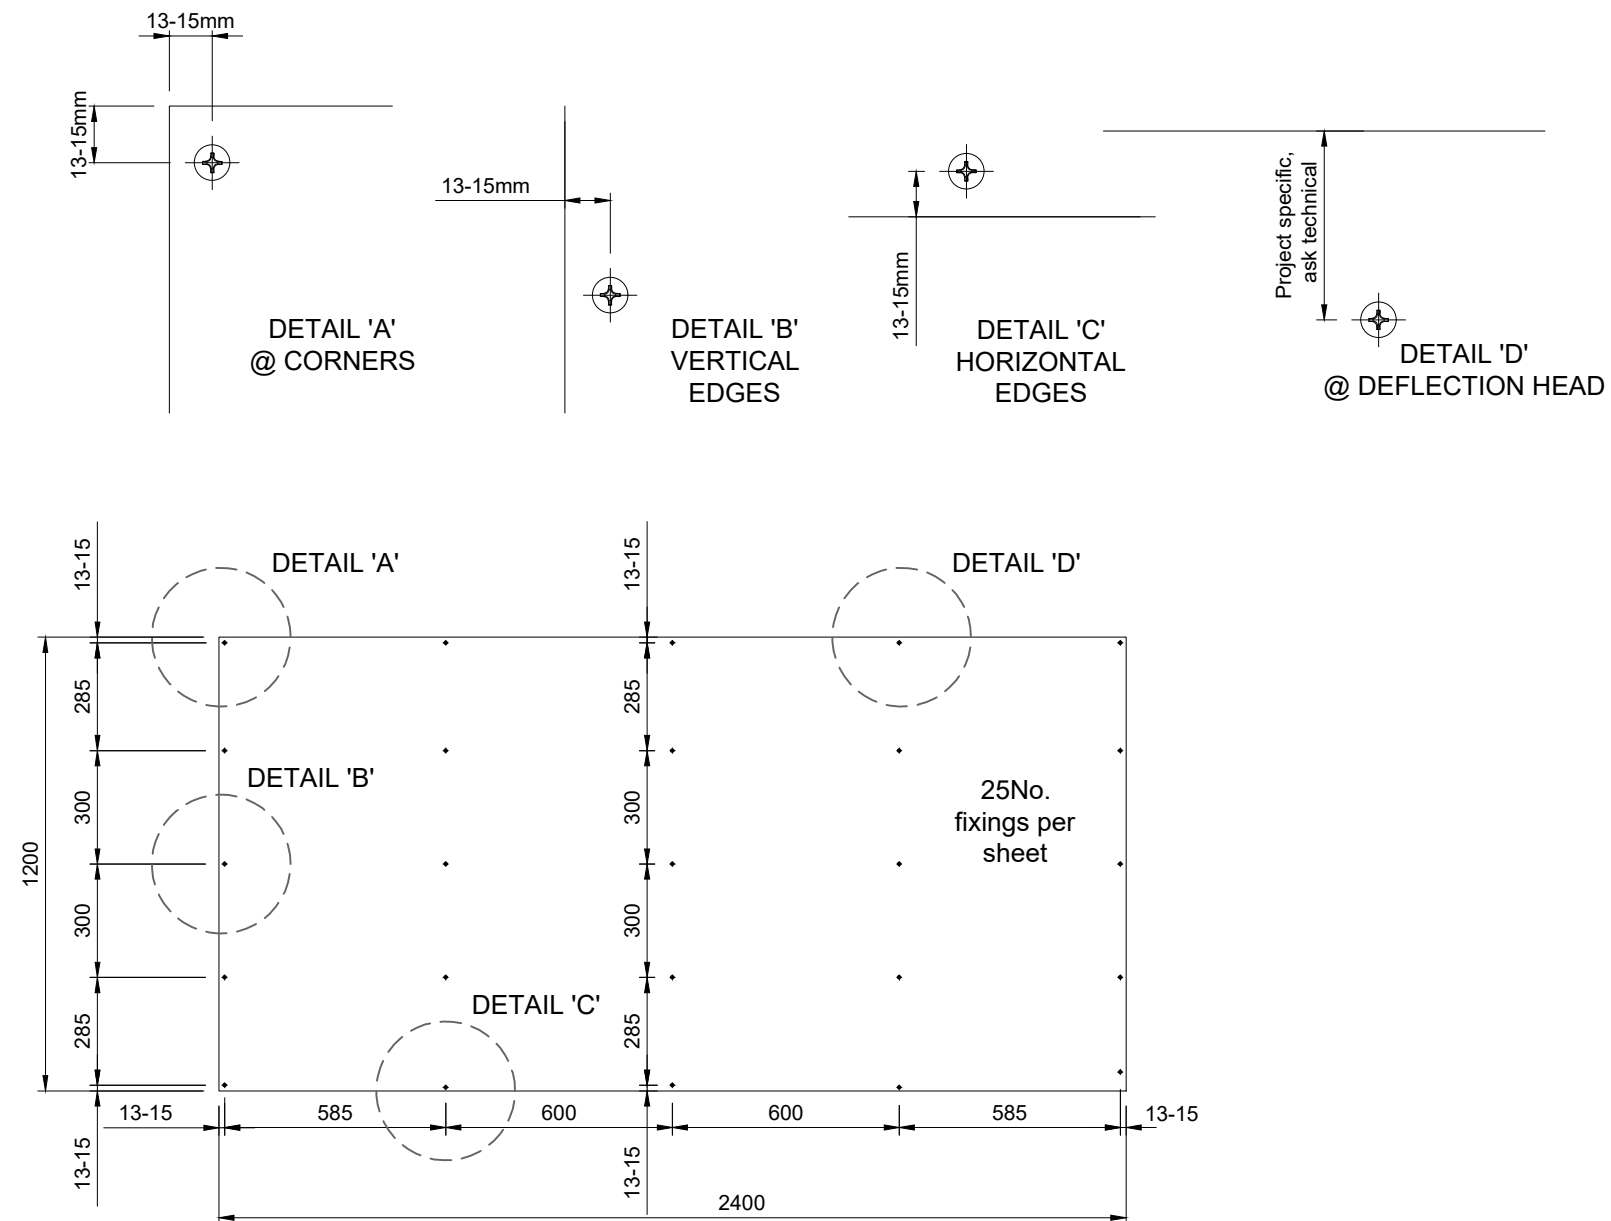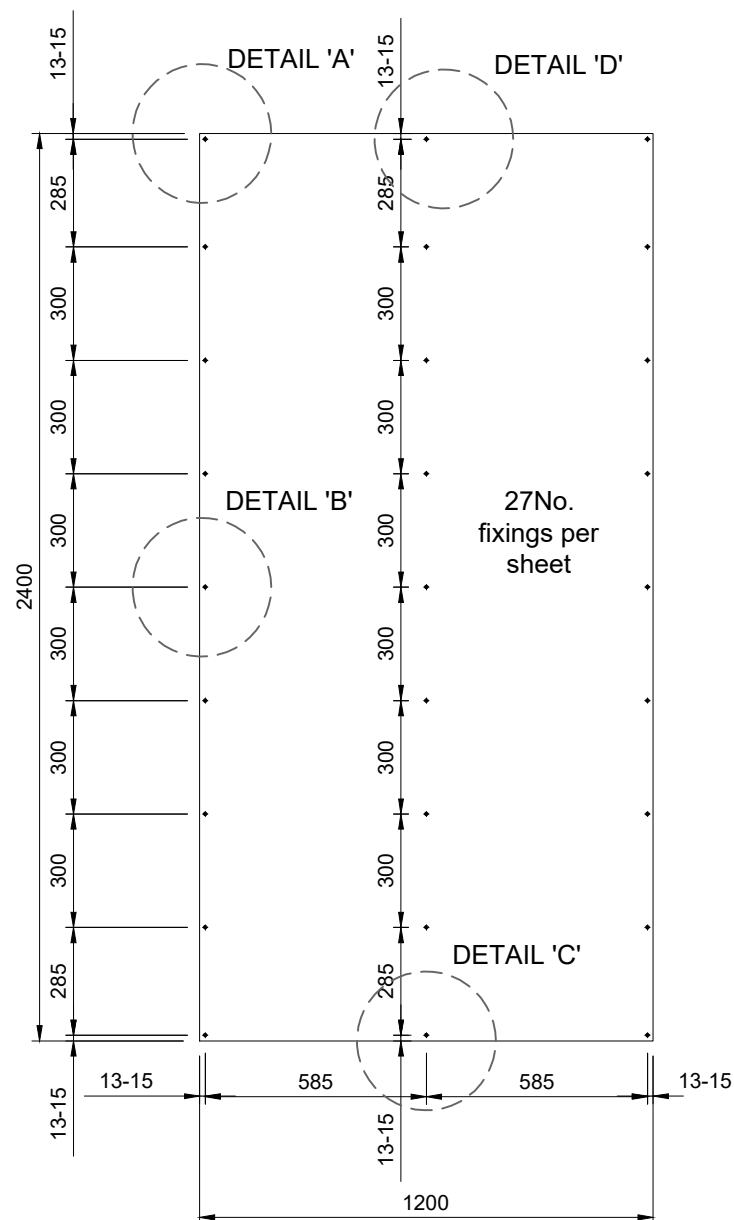

Board joint to be filled with RCM Approved Sealant or tape for fire & or air leakage.

MINIMUM EDGE DISTANCE 13-15mm

| REV | DATE | NOTE | BY |
|-----|----------|-------------|-----|
| - | 04/11/22 | First Issue | MTM |



**Benx Ltd, Lonsdale Chambers,
Lonsdale Street,
Stoke-on-Trent
Staffordshire
ST4 4BT
Telephone: 0845 130 0983
Email:
technicalservices@benx.co.uk**

STATUS: INFORMATION

| | |
|-------------------------------|--------------|
| PROJECT: | ISO No: 5156 |
| Building Boards Fixing Guides | |

DRAWING No: BBFG-D-01

DESCRIPTION:
Densglass Typical fixing details

| | | | | |
|---------------|------------------|--------|-------------------|-----------|
| DRAWN: MTM | CHECK: MTM/DM | NTS@A3 | DATE: Nov/2022 | REV: - |
|---------------|------------------|--------|-------------------|-----------|

All performance data & systems specifications are for systems constructed with materials & components as shown. The inclusion or substitution of any other manufacturers materials or components invalidates both test data, system performance and compliance with CCR. The recipient of this information is not to be used for any purpose, received which are assumed to include all the relevant facts and data. While it is believed to be correct, we accept no liability for its accuracy, adequacy or completeness. Recipients must satisfy themselves as to the accuracy and completeness of the information. Any claims or consequential loss. Acceptance of the content and subsequent design responsibility rests entirely with the recipients. Any change or modification to the information must be in writing and in a written format will void this detail. None of the content may be copied without the prior approval from the GenX Group Technical Services Department. This statement should be read in conjunction with the disclaimer on the back of this document.