



Benx Rainscreen System

Typical Details : Slipfast timber batten on timber frame substrate



Benx Ltd


Lonsdale Chambers
Lonsdale Street, Stoke-on-Trent
Staffordshire
ST4 4BT

technical@spsenvirowall.co.uk

0800 6124662



System:	Slipfast, Timber Batten, Timber Frame Substrate
Insulation:	n/a
System Finish:	Slipfast extruded clay brickslips
Accreditation:	3145 SlipFast BAW-20-172-S-A-UK 21.07.22 CD N3P
Naming Sequence	Typical Details, Slipfast, Timber Batten, Timber Frame, Brickslip, 01, etc
Drawing Codes	TD-SF-TB-TF-BS-01
ISO Reference	5806

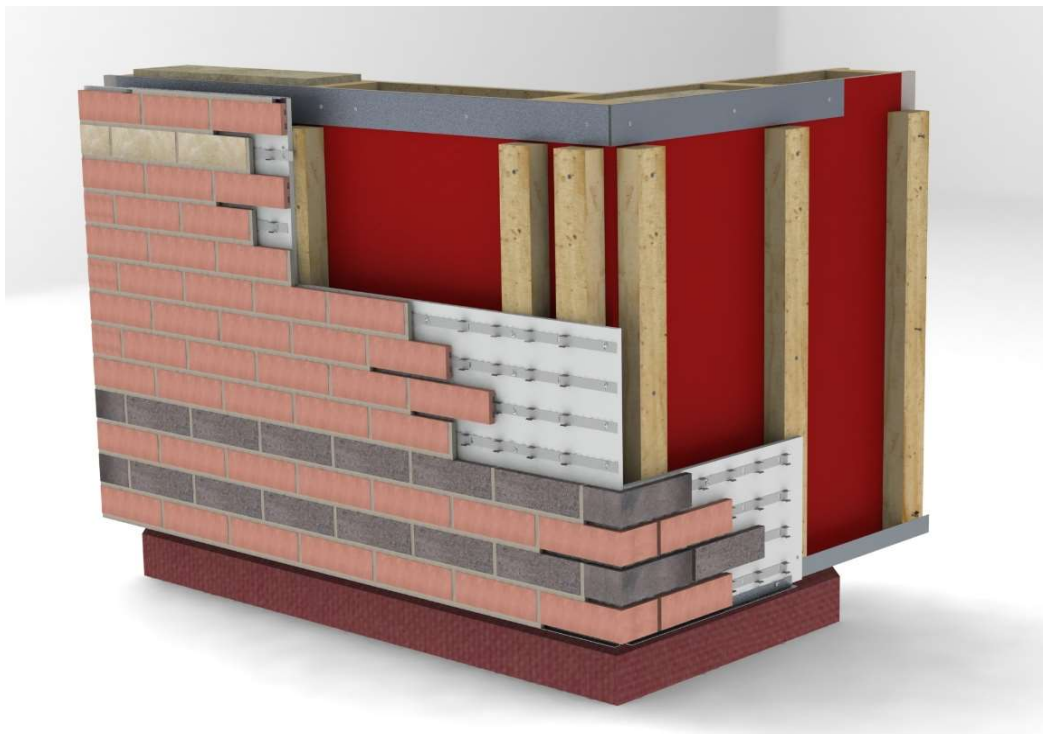

Typical Image / Section through Rainscreen System onto Sheathing Board

GENERAL NOTES

This document is intended as a design guidance documentation and to assist the Project design team in producing the respective documentation for any project under consideration or installation. To be read with Relevant H92 Specification and accordance with Benx SPS, and RCM Installation instructions and good practice guidelines.

As manufacturers/suppliers Benx Technical is not privy to detailed contractual arrangements and documentation of individual projects and is therefore not in a position to co-ordinate related work by others. It is not the intention for this draft to relate to any particular project, but to provide a guide to the more common items to encountered in construction assemblies incorporating Benx, SPS, and RCM products.

Finally please ensure that any amendments to Benx Technical draft specifications represent a true interpretation of the project designer's requirements.




DRAWING REGISTER

DRAWING REGISTER

[illegible]

Note

- 1. For information please see Benx Certification Documents.
- 2. All board joints sealed with RCM Products.

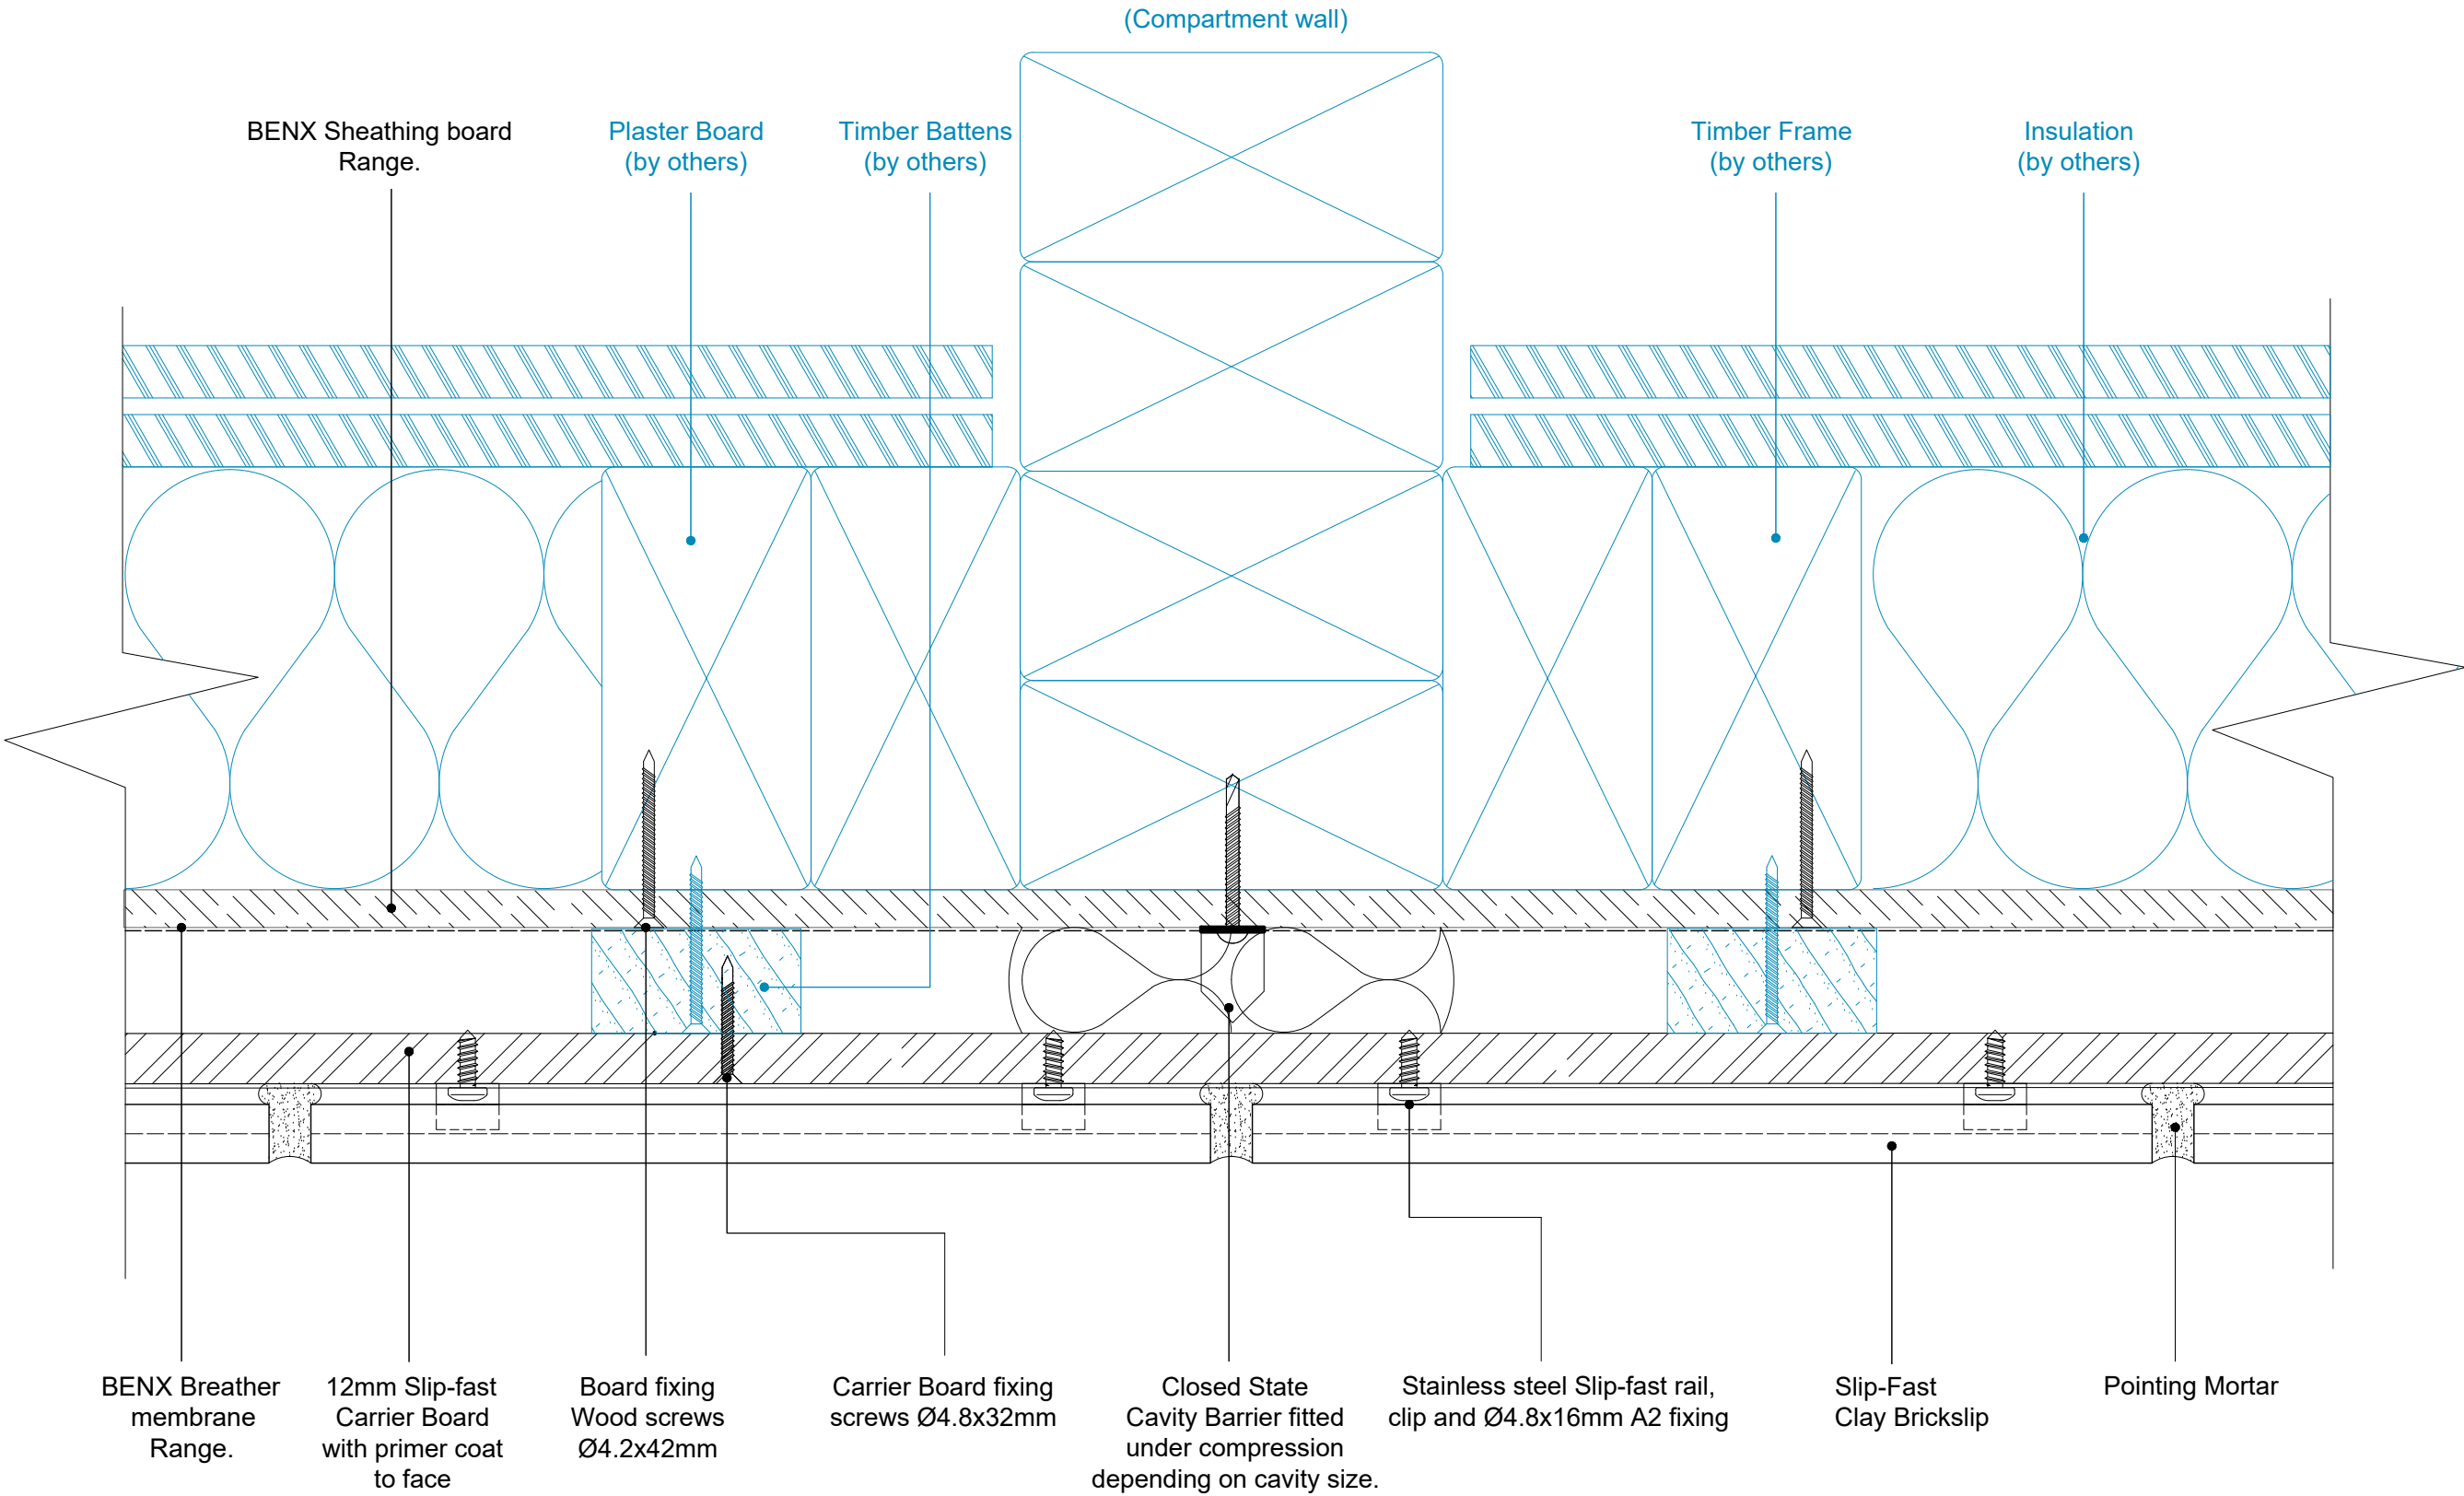


Benx Ltd, Lonsdale Chambers,
Lonsdale Street,
Stoke-on-Trent
Staffordshire
ST4 4BT
Telephone: 0845 130 0983
Email:
technicalservices@benx.co.uk

All performance data & systems specifications are for systems constructed with materials & components as shown. The inclusion or substitution of any other manufactures materials or components invalidates both test data, system performance and compliance with CDM 2015. The information is provided and based upon details received, which are assumed to include all the relevant facts and data. While it is believed to be correct, we accept no liability for its accuracy, adequacy or completeness. Recipients must satisfy themselves as to its suitability as we do not accept responsibility for any claims or consequential loss. Acceptance of the content and subsequent design responsibility rests entirely with the recipients. Any subsequent design changes that affect the detail which we are not informed of in a written format will void this detail. None of the content may be copied without the prior approval from the Benx Group Technical Services Department. This statement should be read in conjunction with the standard terms and conditions of Benx Group.

REV	DATE	NOTE	BY	STATUS:	INFORMATION	DRAWN:
A	15/04/23	First Issue	AG	PROJECT:	Slipfast-Brickslip Rainscreen System	AG
B	21/02/24	Text and fixing information updated	AG	ISO No:	5806	MT
				DRAWING No:	5806-TD-SF-TB-TF-BS-0.01	NTS@A3
				DESCRIPTION:	VERTICAL FIRE BARRIER	DATE:
						Apr 23
						REV:
						B

Note


- 1. For information please see Benx Certification Documents.
- 2. All board joints sealed with RCM Products.

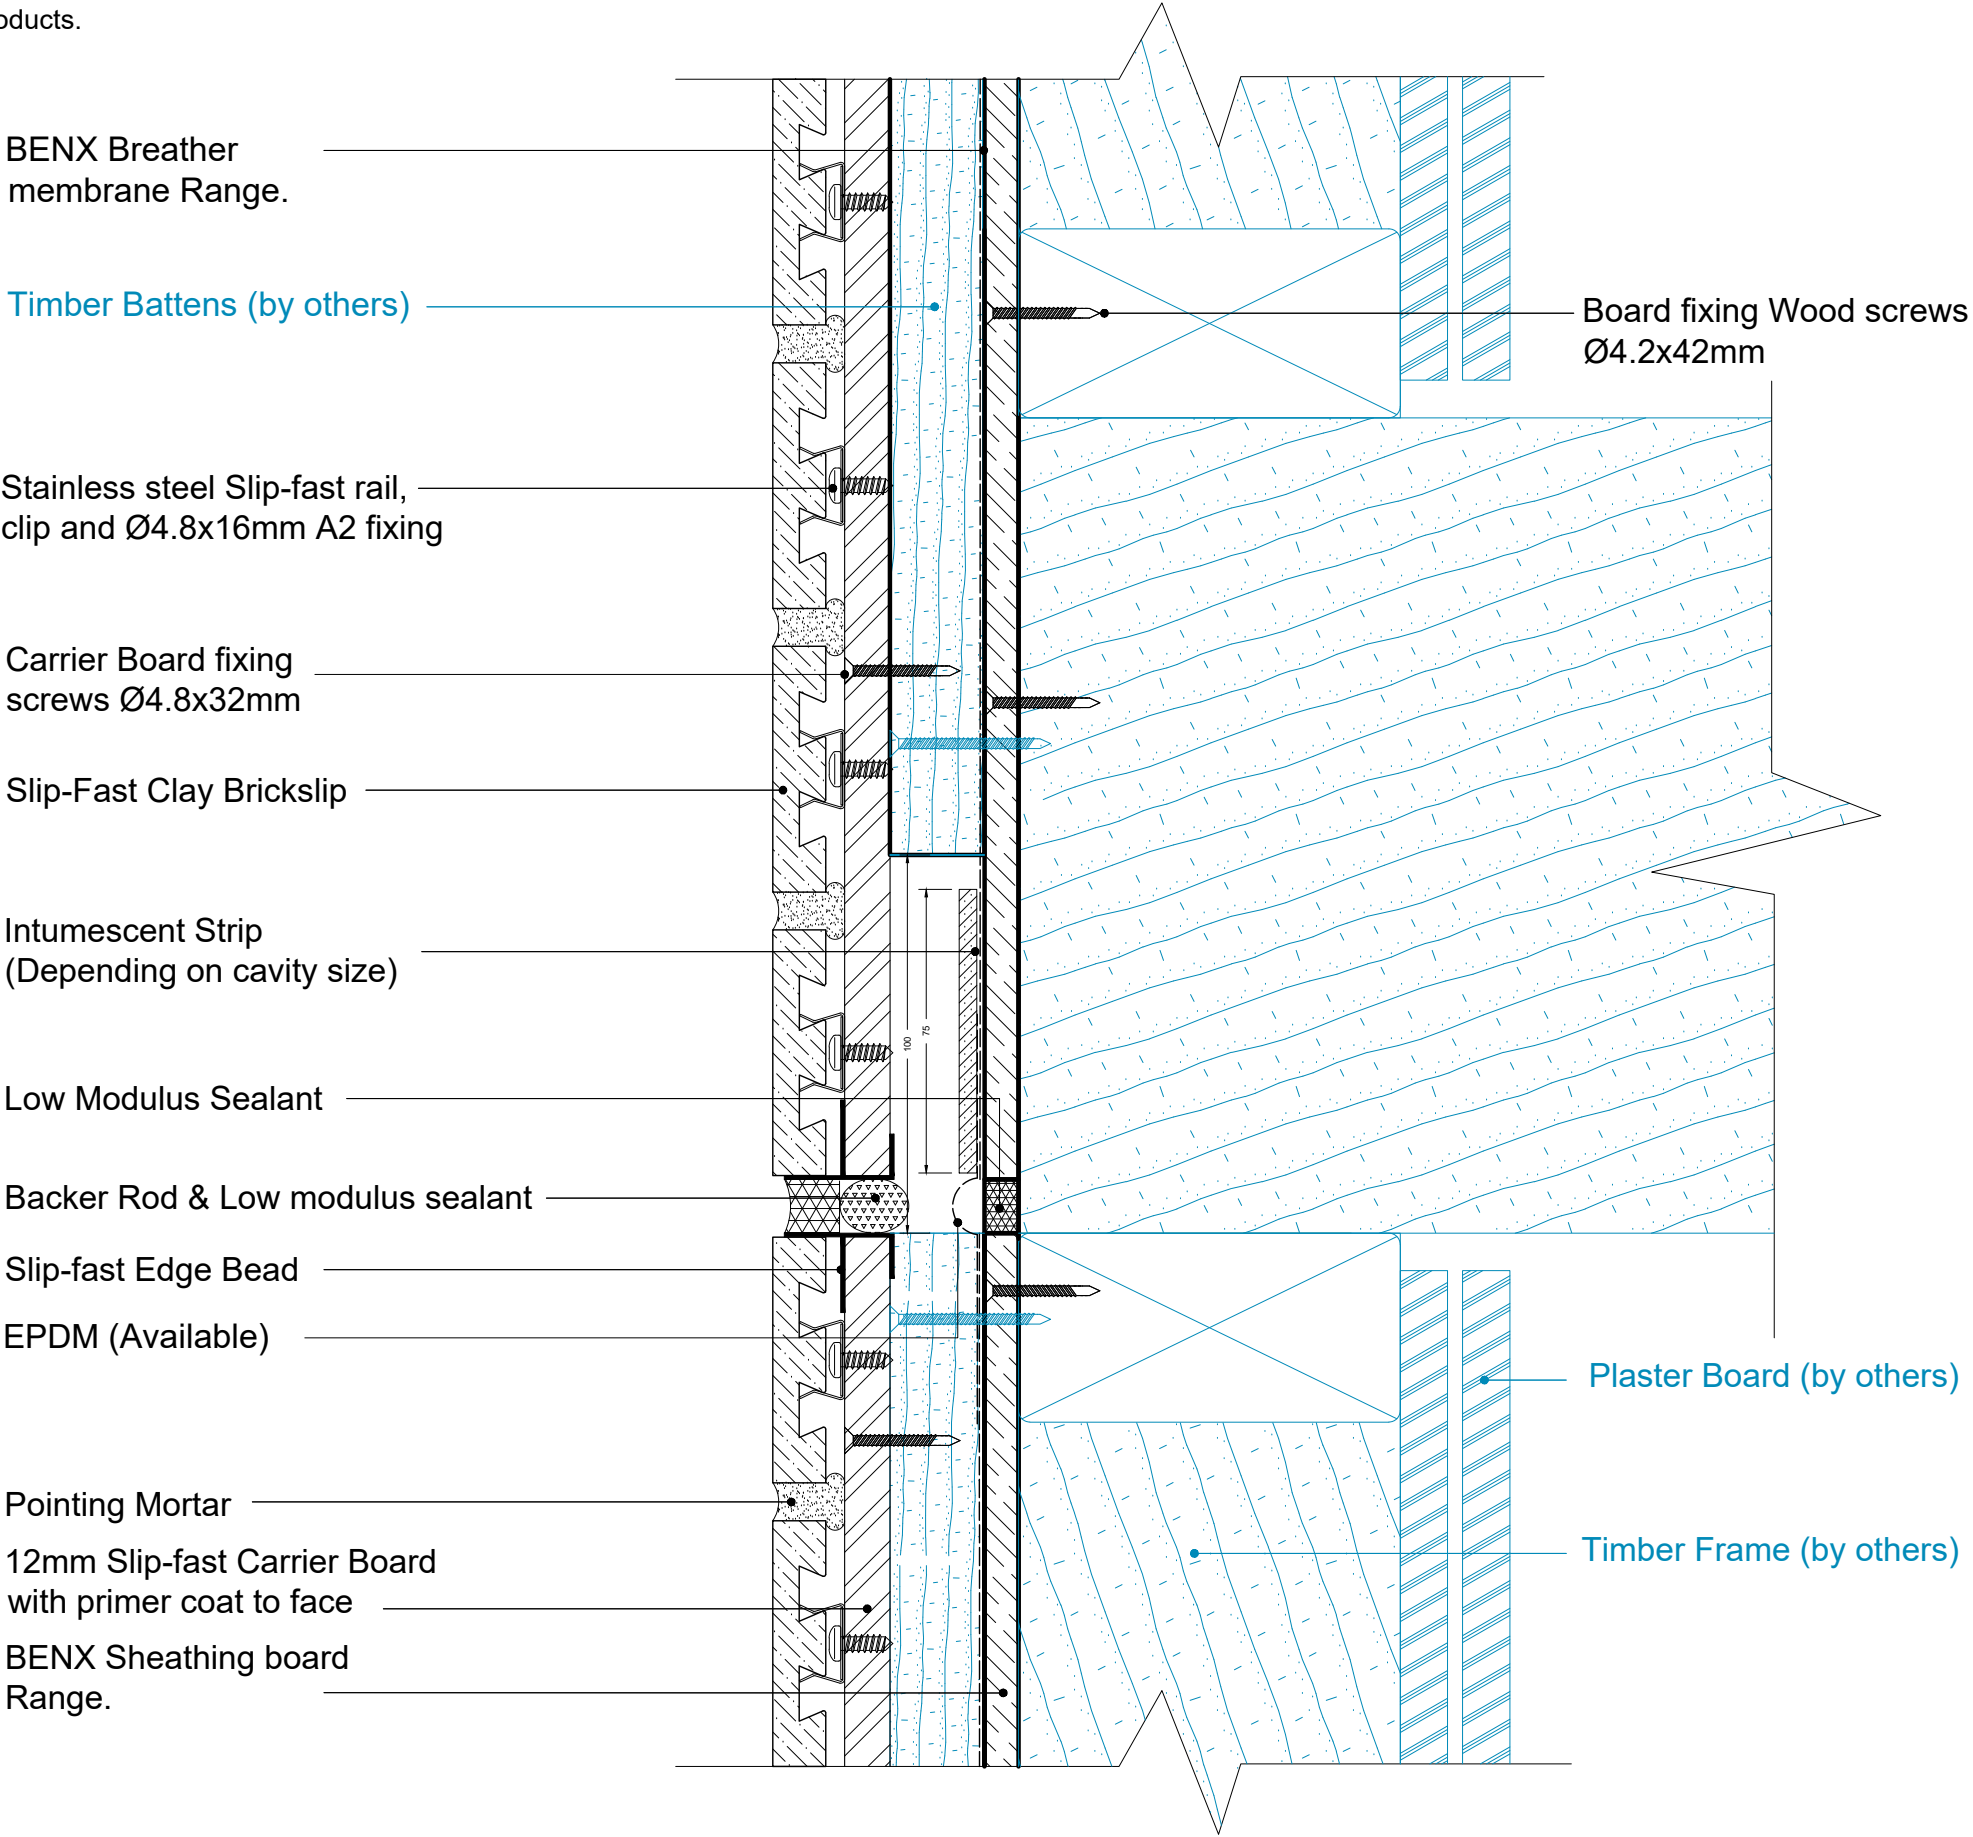

REV	DATE	NOTE	BY	STATUS:	AG	AG	AG	AG	AG	AG	
A	15/04/23	First Issue	AG	AG	AG	AG	AG	AG	AG	AG	
B	21/02/24	Text and fixing information updated	AG	AG	AG	AG	AG	AG	AG	AG	
				PROJECT:		Slipfast-Bricksip Rainscreen System		ISO No: 5806		DRAWN: AG	
				DRAWING No:		5806-TD-SF-TB-TF-BS-0.02		DATE:		Apr 23	
				DESCRIPTION:		VERTICAL SECTION WITH DEFLECTION HEAD		REV:		B	

Note


- 1. For information please see Benx Certification Documents.
- 2. All board joints sealed with RCM Products.

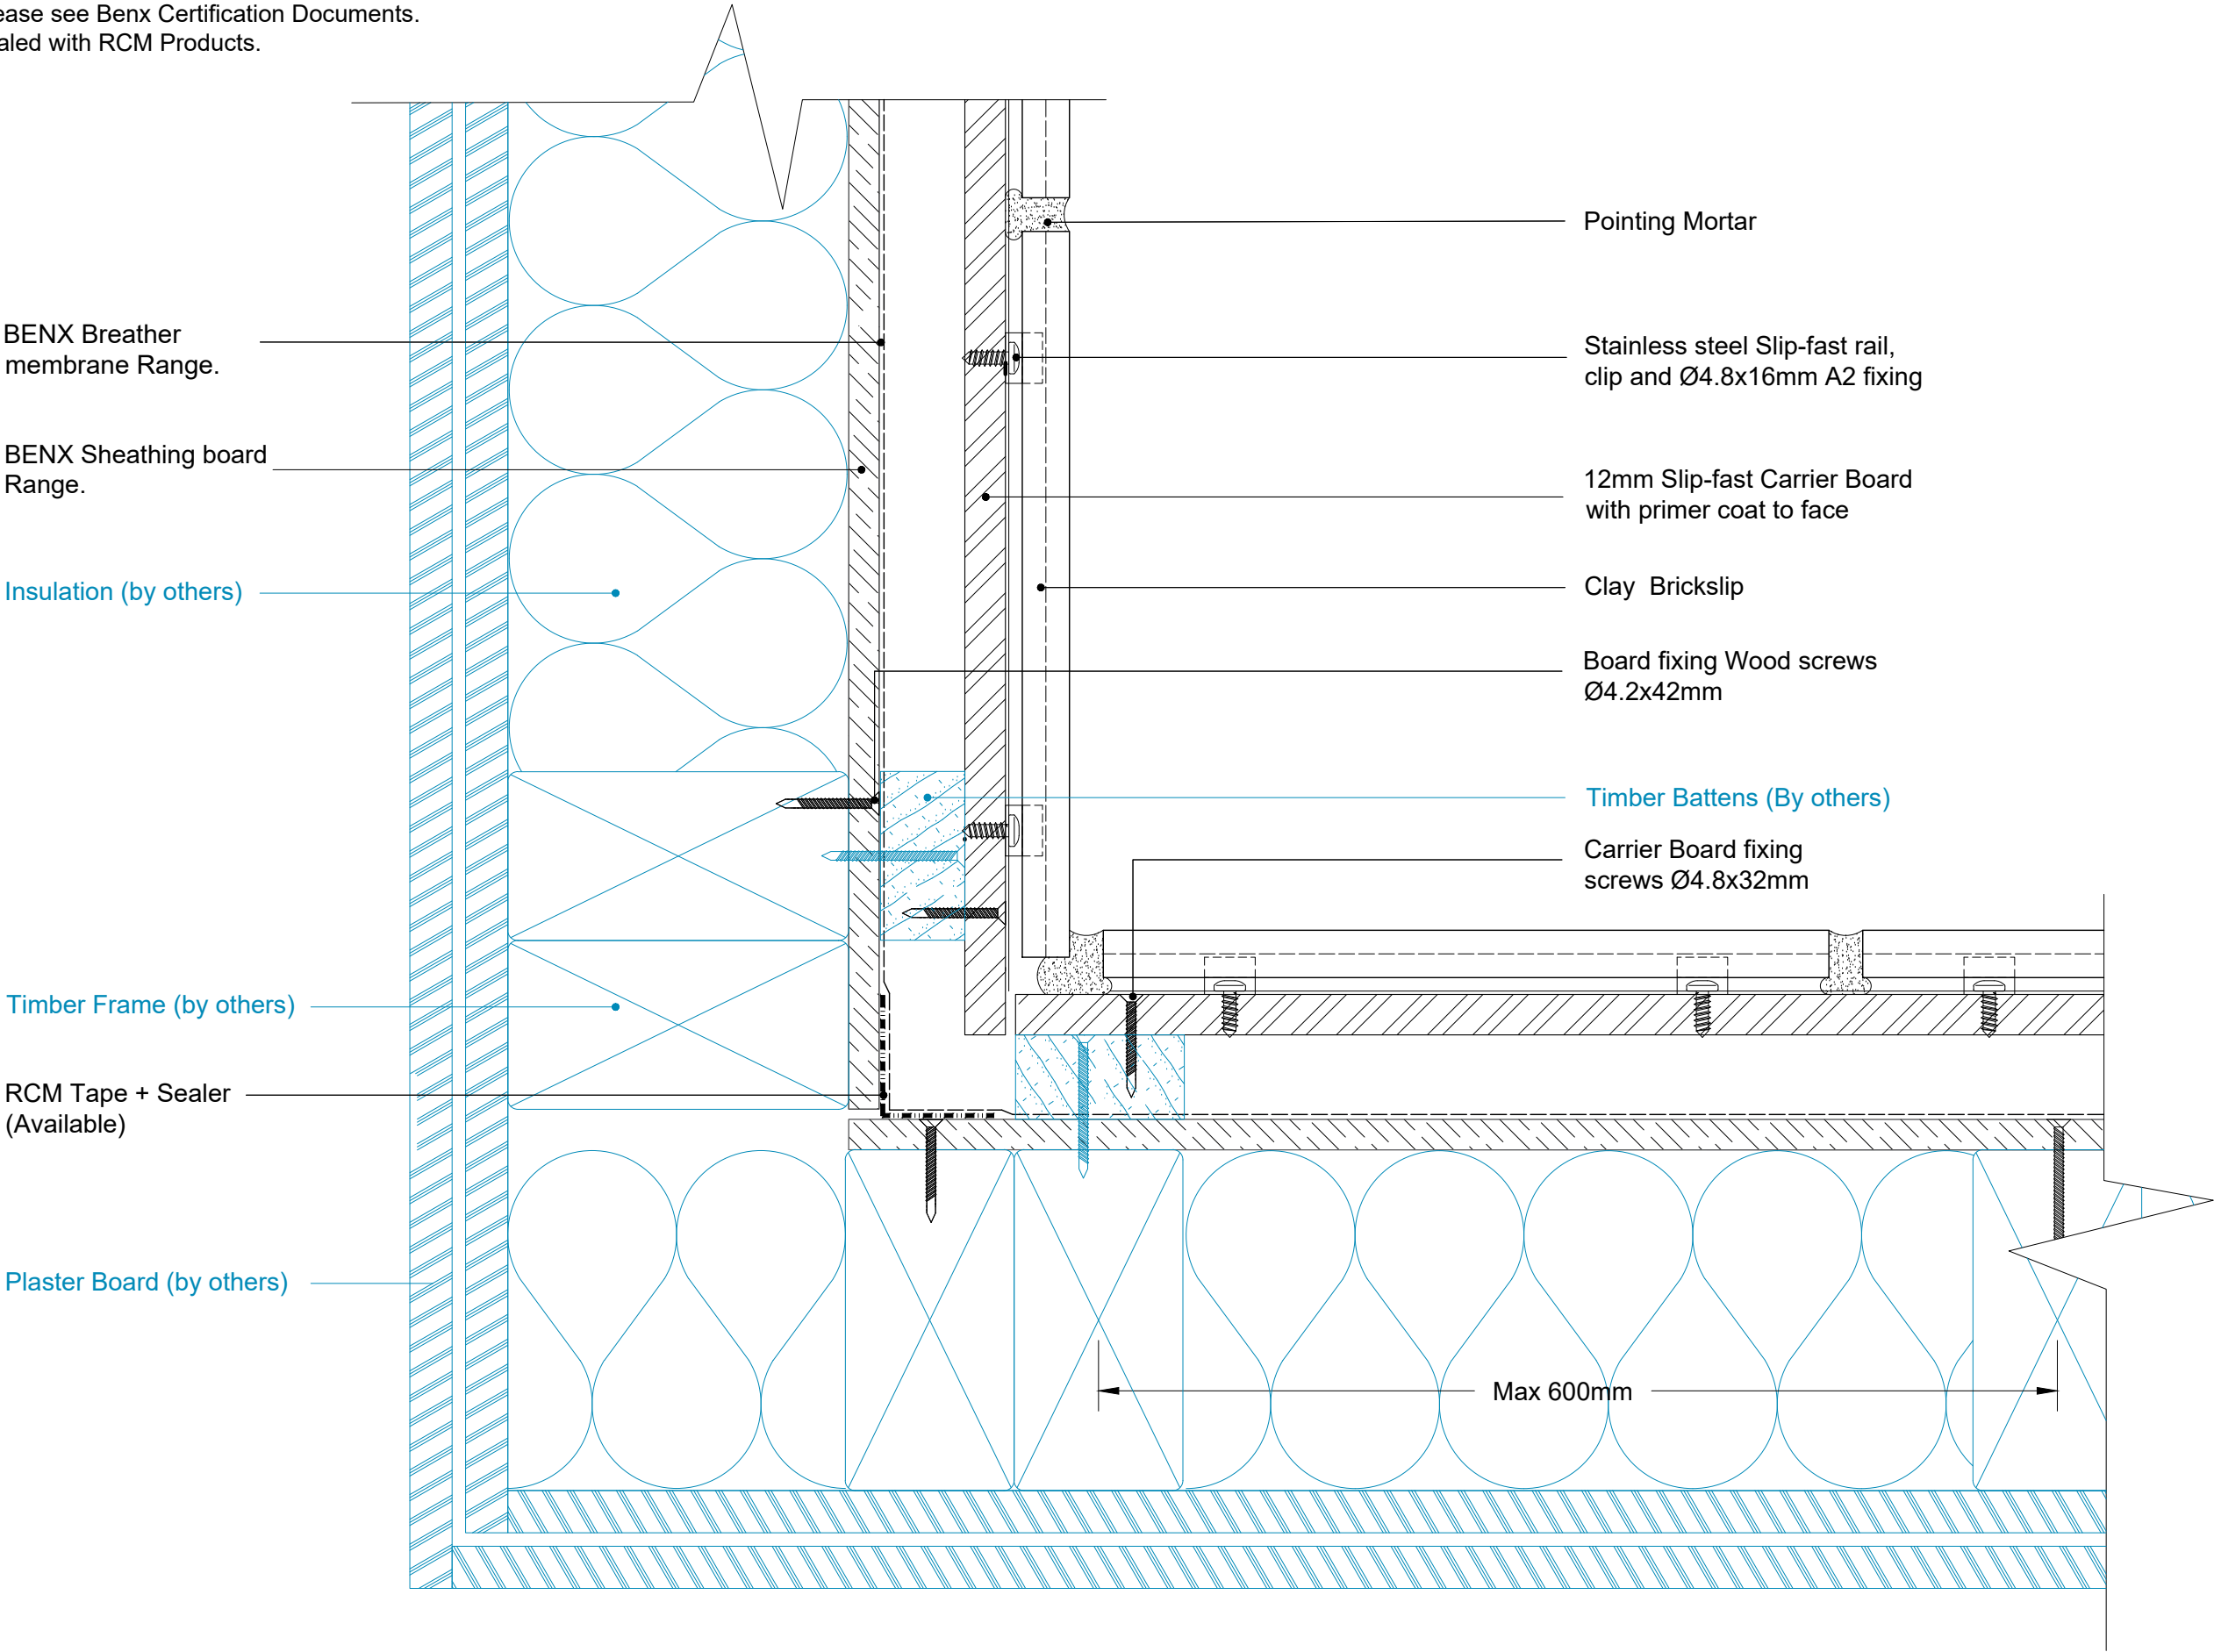

REV	DATE	NOTE	BY	STATUS:	AG	AG	AG	AG	AG	AG
A	15/04/23	First Issue	AG	AG	AG	AG	AG	AG	AG	AG
B	21/02/24	Text and fixing information updated	AG	AG	AG	AG	AG	AG	AG	AG
				STATUS: INFORMATION		PROJECT: Slipfast-Bricksip Rainscreen System				
						ISO No: 5806				
						DRAWING No: 5806-TD-SF-TB-TF-BS-0.03				
						DESCRIPTION: INTERNAL CORNER				
						DATE: Apr 23				
						REV: B				

Note

- 1. For information please see Benx Certification Documents.
- 2. All board joints sealed with RCM Products.

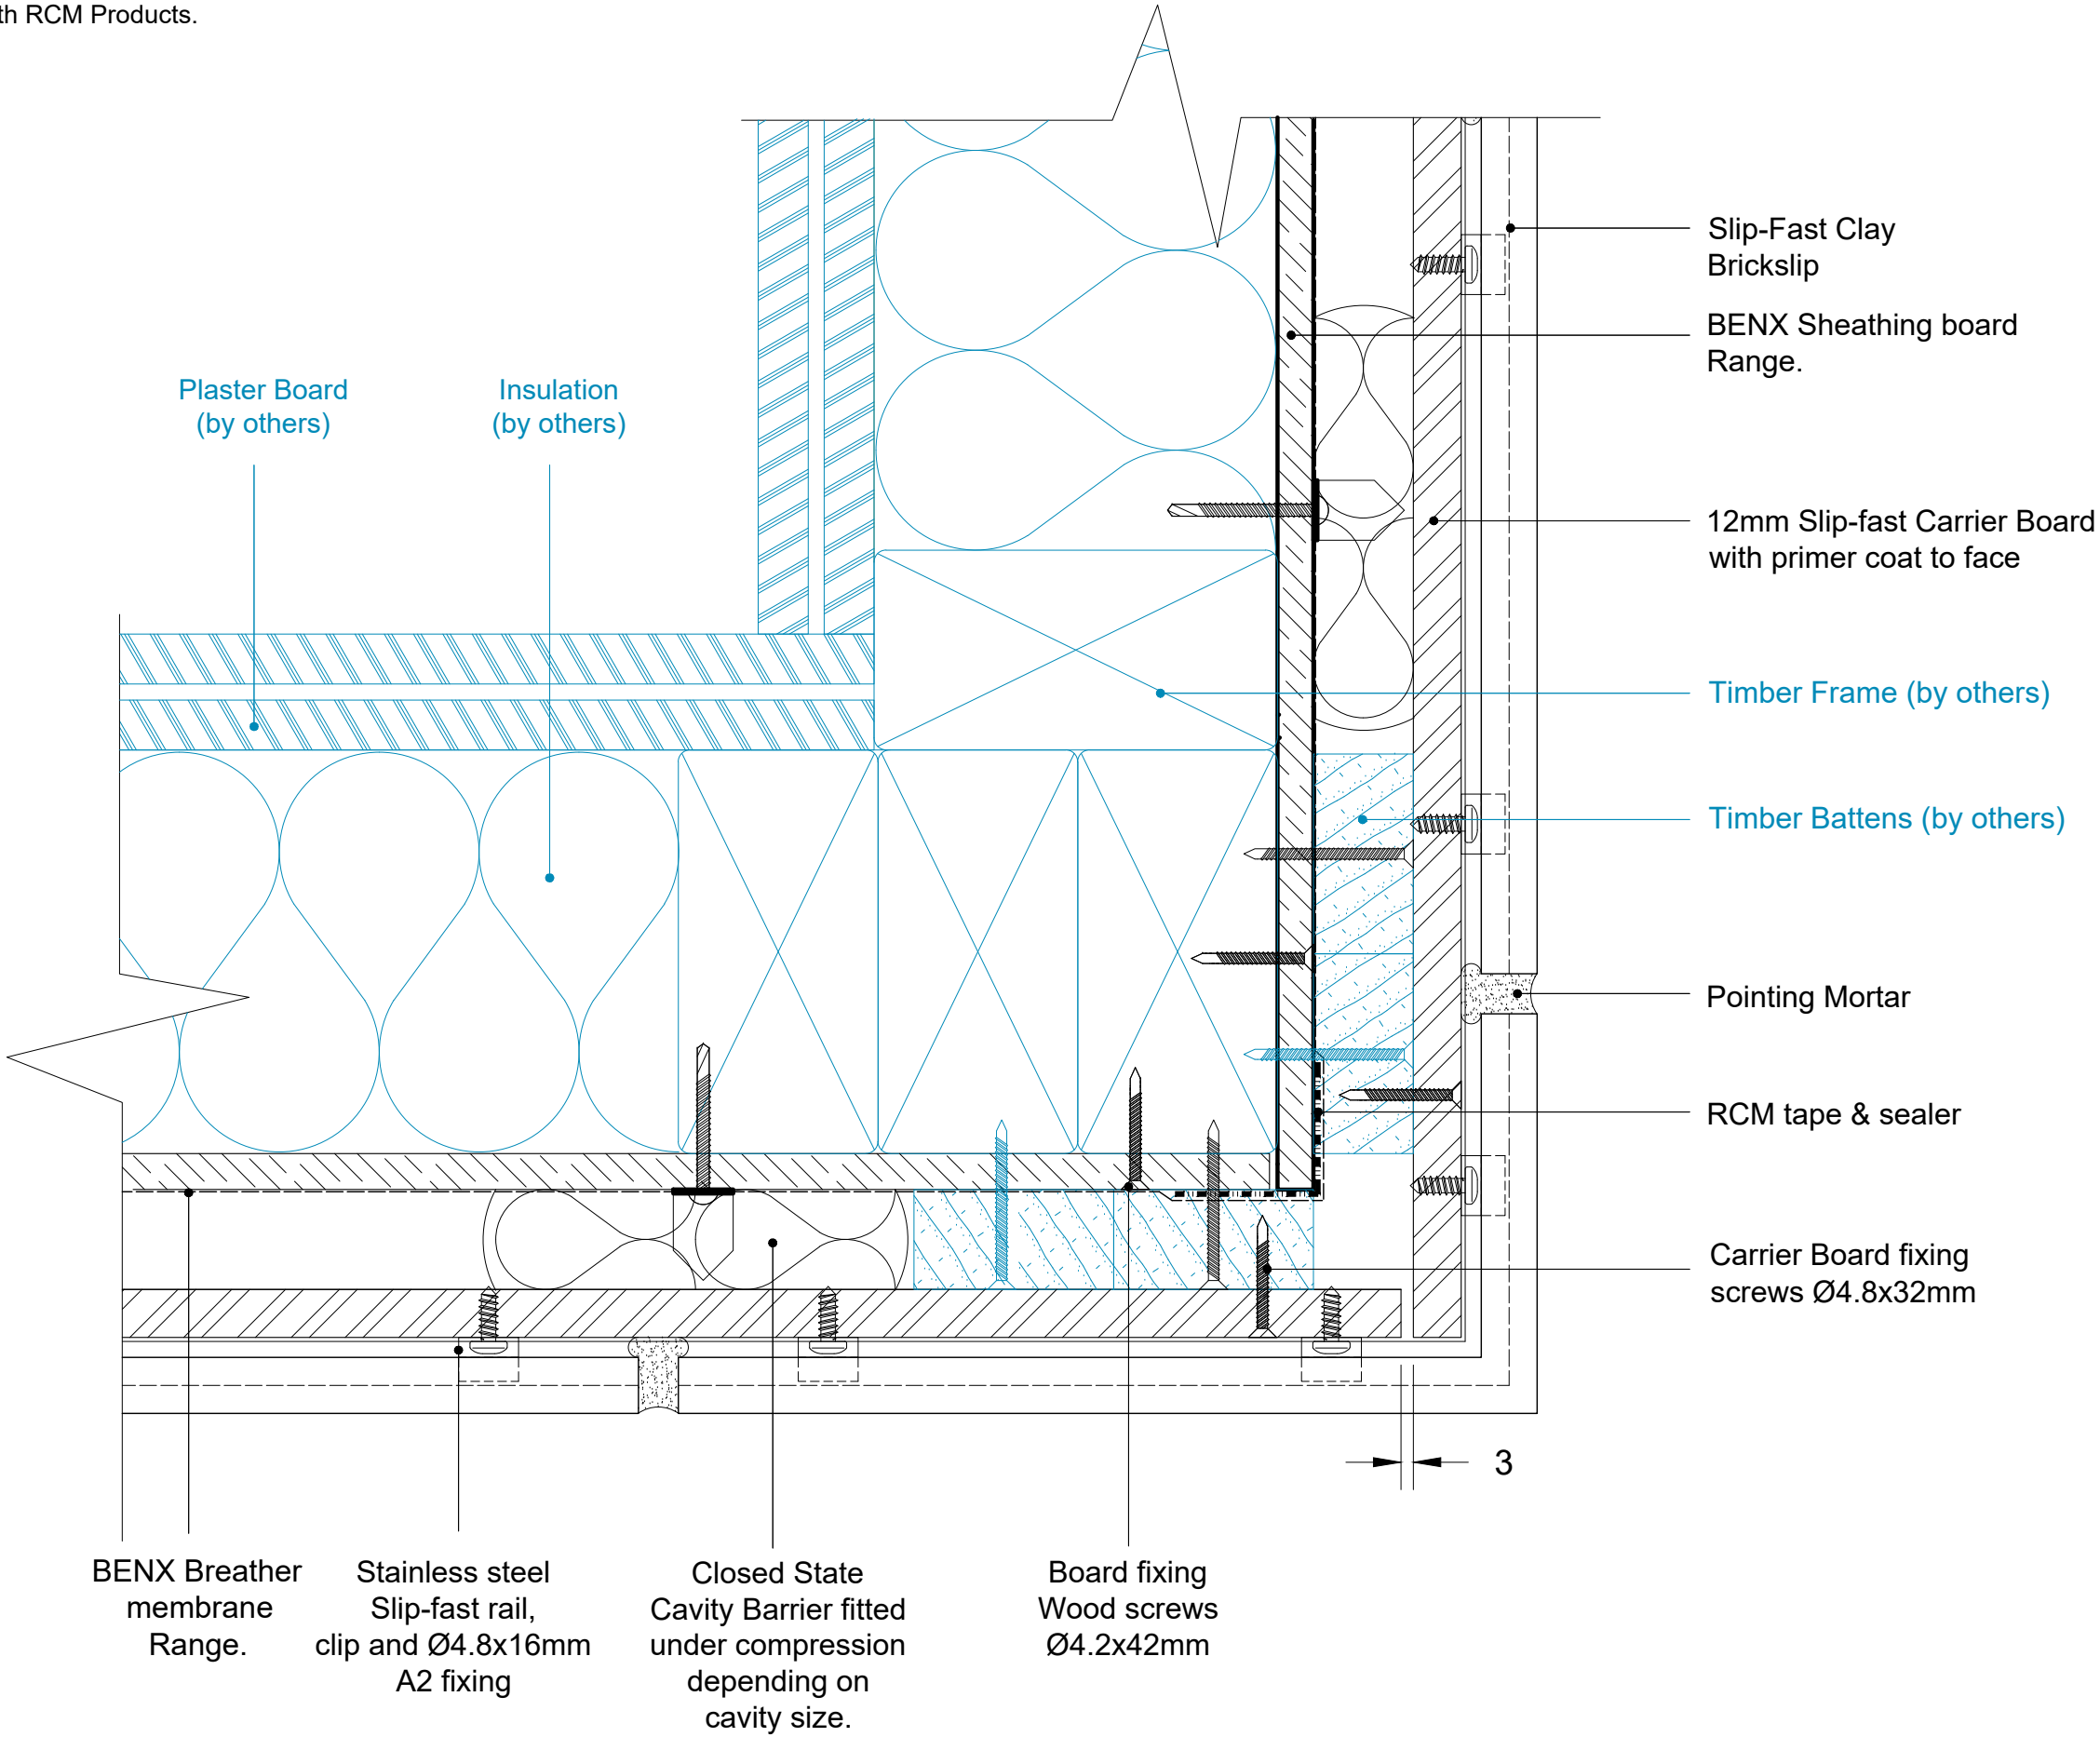


Benx Ltd, Lonsdale Chambers,
Lonsdale Street,
Stoke-on-Trent
Staffordshire
ST4 4BT
Telephone: 0845 130 0983
Email:
technicalservices@benx.co.uk

All performance data & systems specifications are for systems constructed with materials & components as shown. The inclusion or substitution of any other manufactures materials or components invalidates both test data, system performance and compliance with CDM 2015. The information is provided and based upon details received, which are assumed to include all the relevant facts and data. While it is believed to be correct, we accept no liability for its accuracy, adequacy or completeness. Recipients must satisfy themselves as to its suitability as we do not accept responsibility for any claims or consequential loss. Acceptance of the content and subsequent design responsibility rests entirely with the recipients. Any subsequent design changes that affect the detail which we are not informed of in a written format will void this detail. None of the content may be copied without the prior approval from the Benx Group Technical Services Department. This statement should be read in conjunction with the standard terms and conditions of Benx Group.

REV	DATE	NOTE	BY	STATUS:	INFORMATION	DRAWN:
A	15/04/23	First Issue	AG	PROJECT:	Slipfast-Bricksip Rainscreen System	AG
B	21/02/24	Text and fixing information updated	AG	ISO No:	5806	MT
				DRAWING No:	5806-TD-SF-TB-TF-BS-0.04	NTS@A3
				DESCRIPTION:	EXTERNAL CORNER	DATE:
						Apr 23
						REV:
						B

Note


- 1. For information please see Benx Certification Documents.
- 2. All board joints sealed with RCM Products.

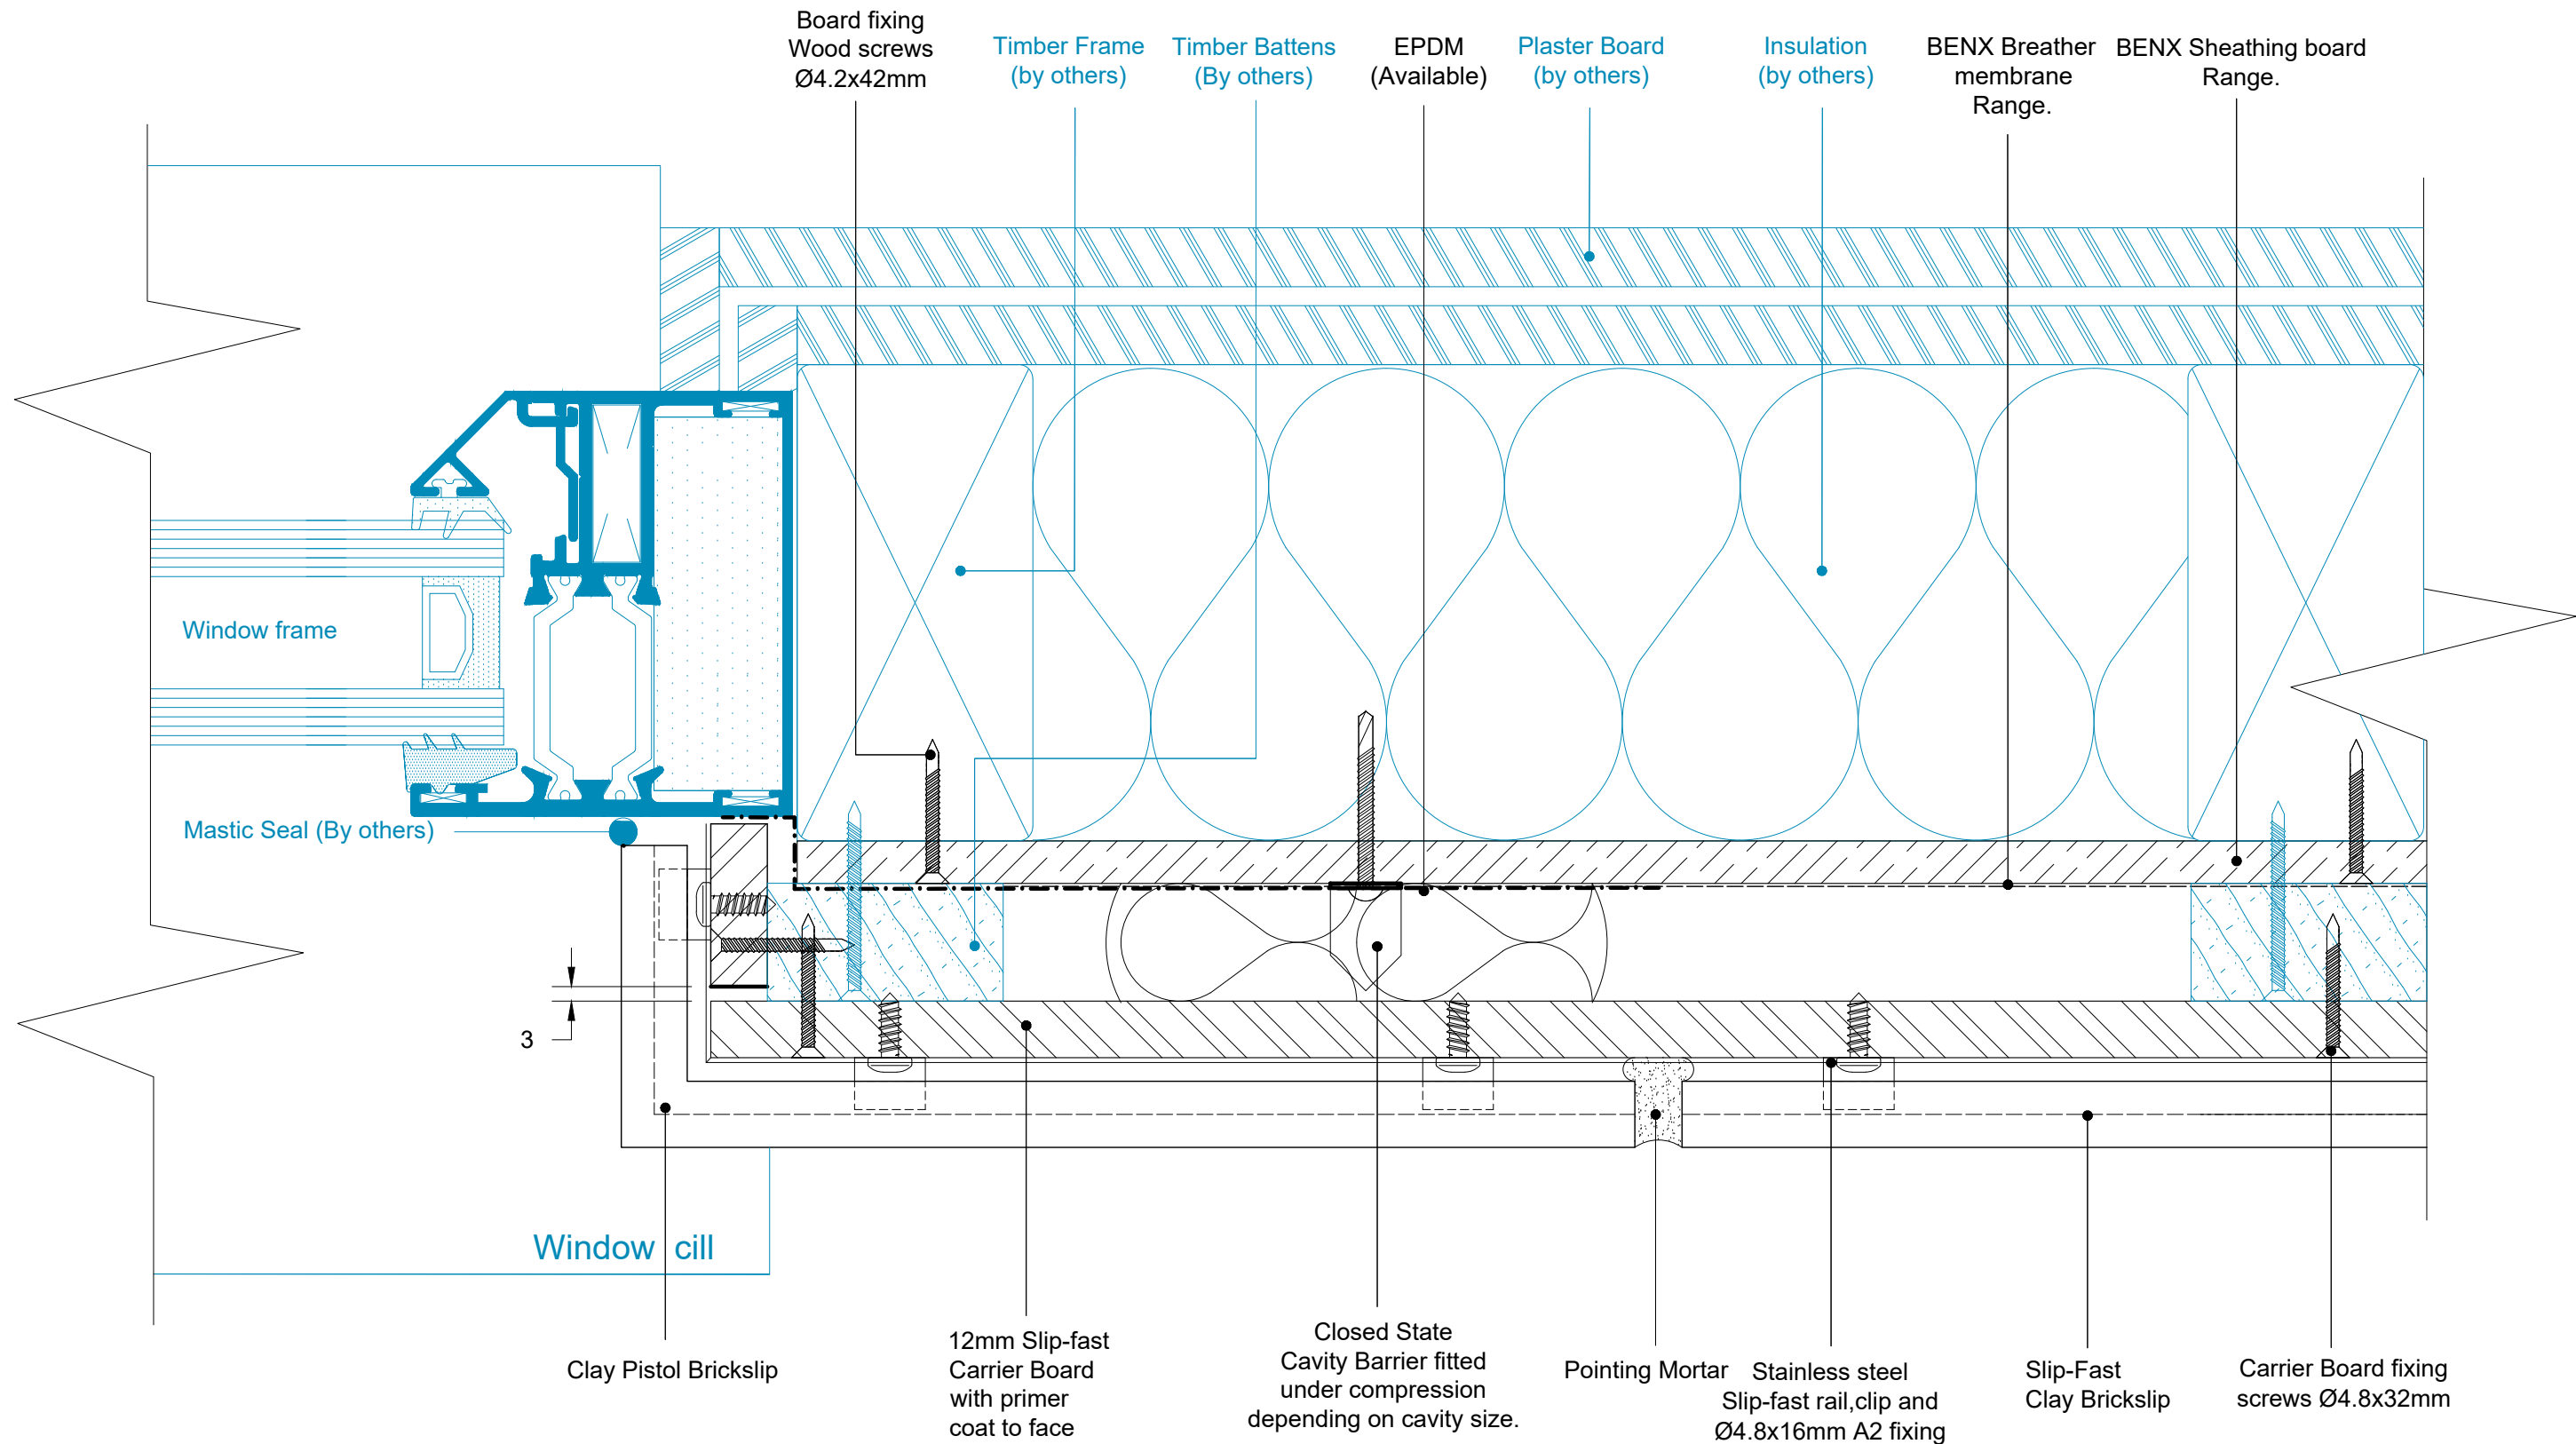


1. For information please see Benx Certification Documents.
2. All board joints sealed with RCM Products.



1. For information please see Benx Certification Documents.
2. All board joints sealed with RCM Products.

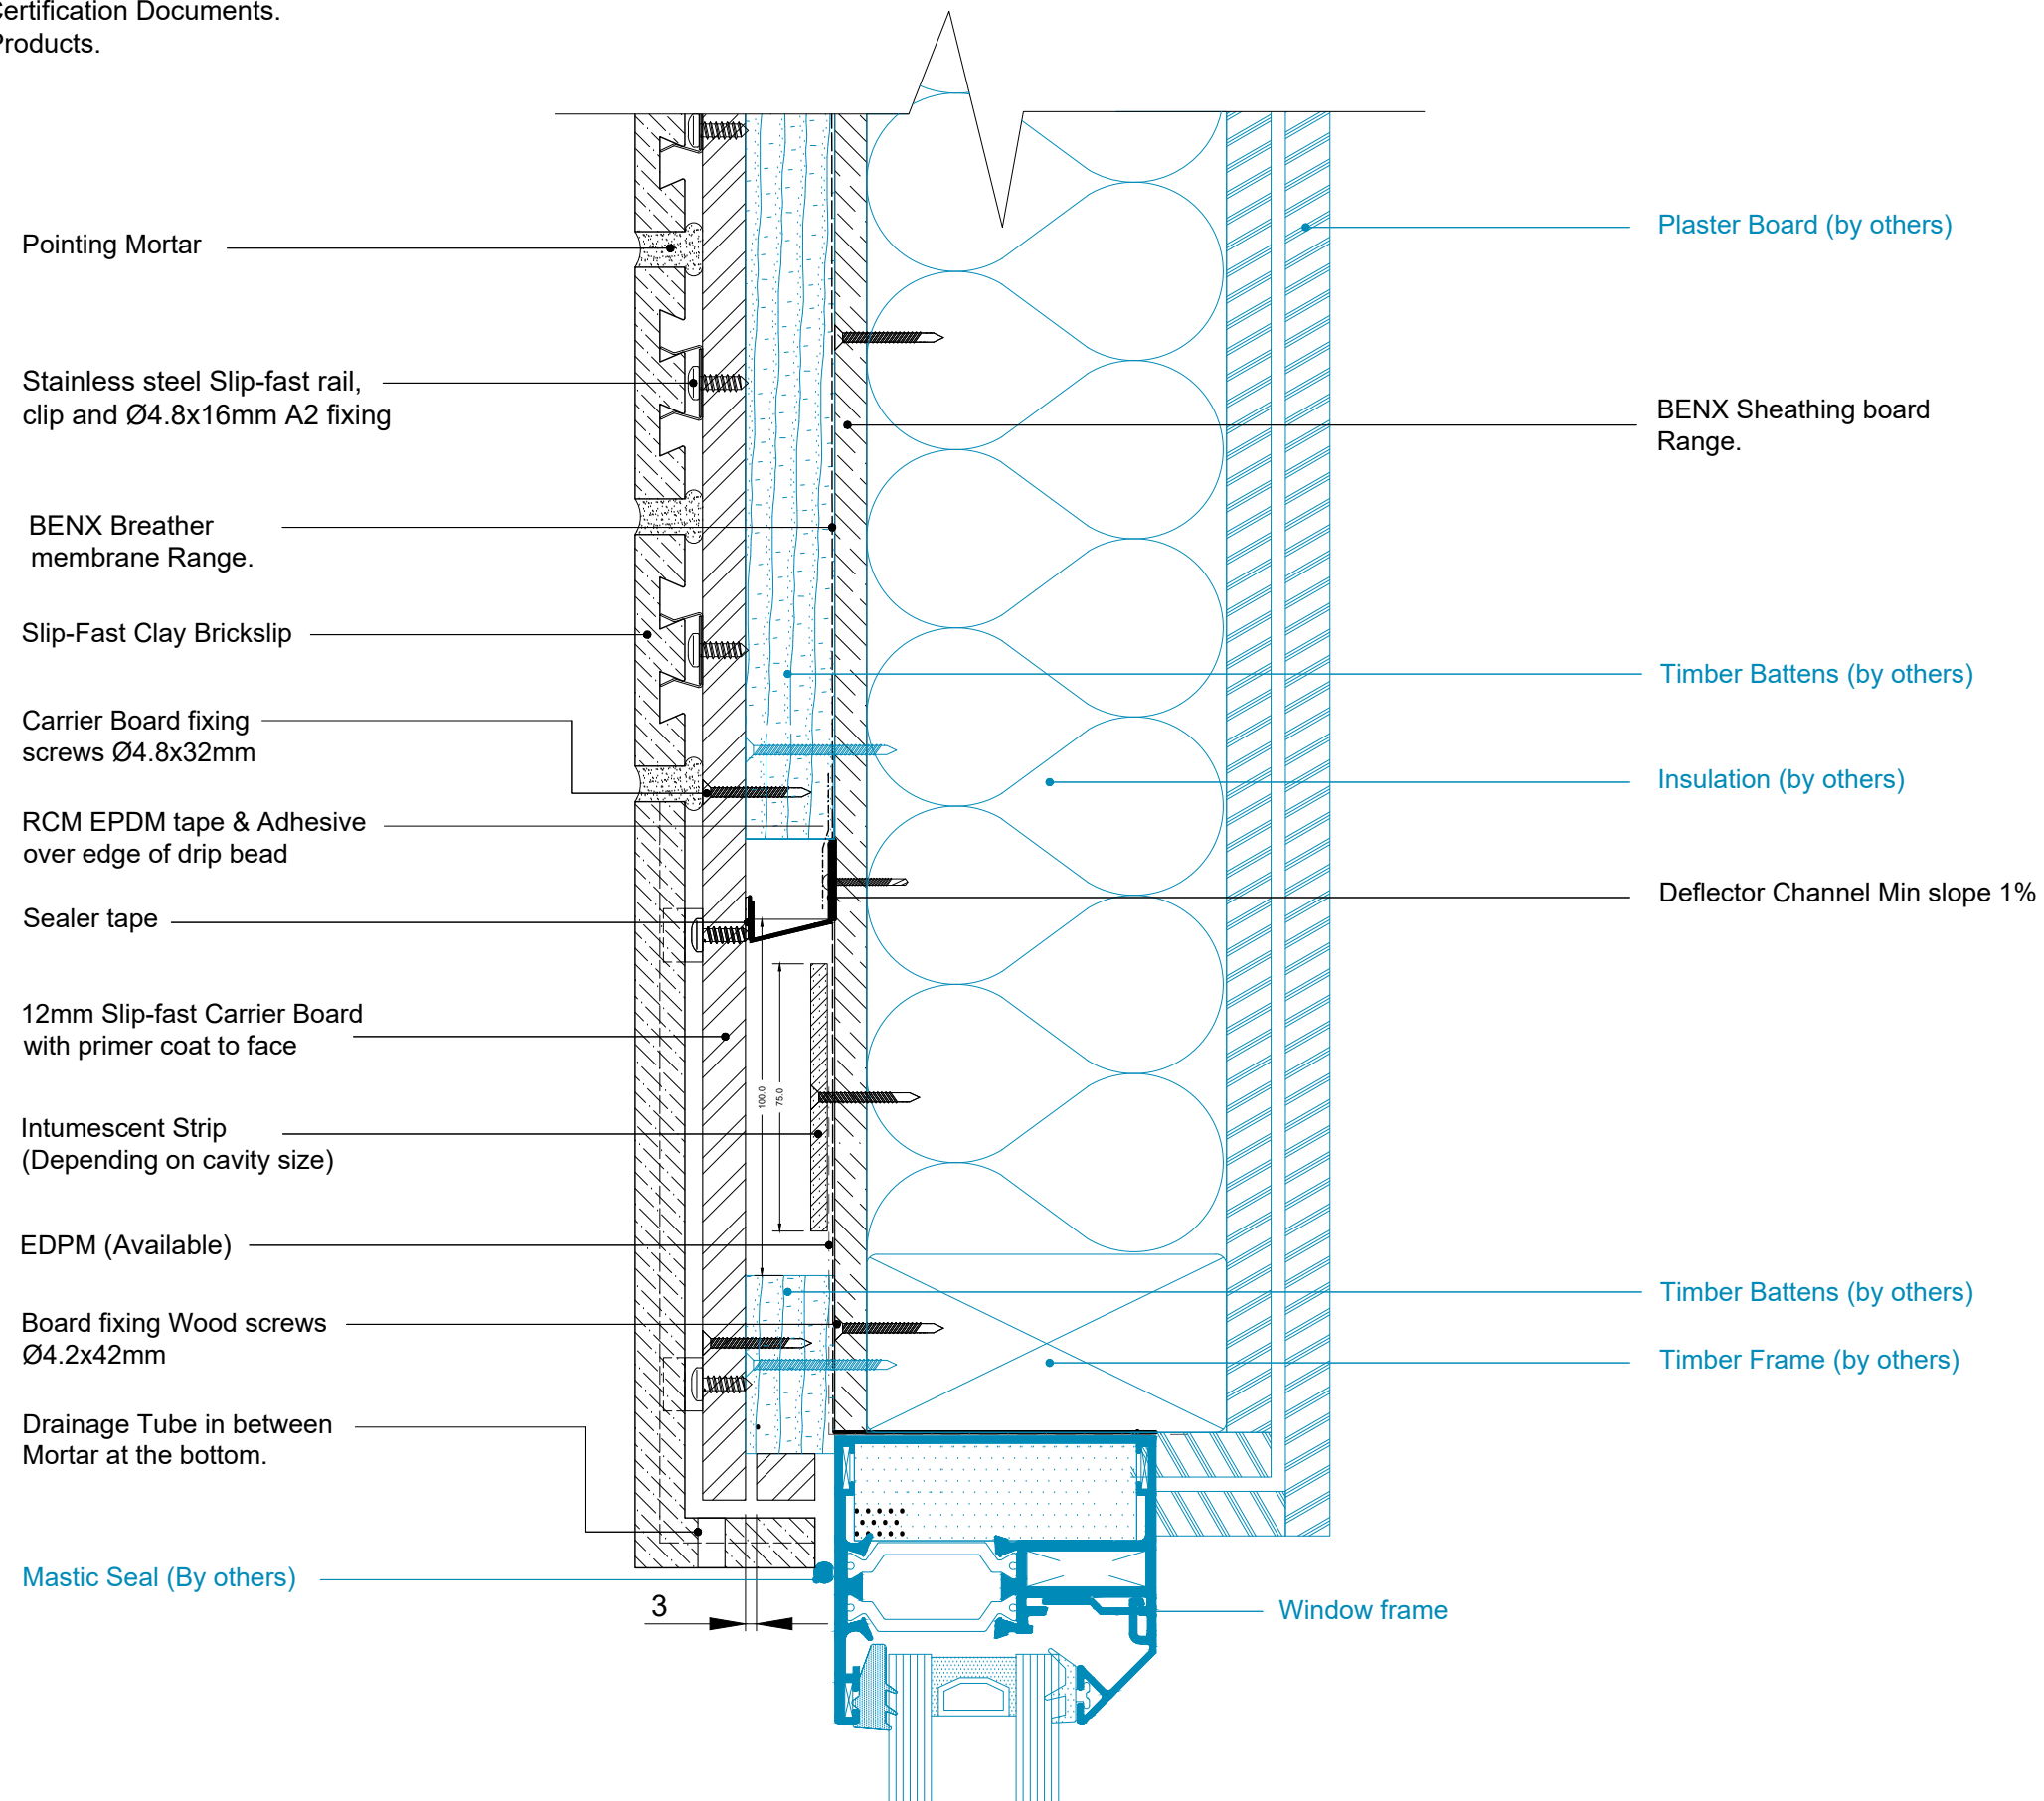

1. For information please see Benx Certification Documents.
2. All board joints sealed with RCM Products.



Timber Battens
(by others)

Insulation
(by others)

Plaster Board
(by others)

Timber Battens
(by others)

Window frame

— BENX Breather
membrane Range.

- Slip-Fast Clay Bricks

Stainless steel Slip-fast rail,
clip and Ø4.8x16mm A2 fixing

- Pointing Mortar

Carrier Board fixing
screws Ø4.8x32mm

12mm Slip-fast Carrier Board
with primer coat to face

Intumescent Strip
(Depending on cavity size)


- EDPM (Available)

— Board fixing Wood screws
Ø4.2x42mm


Slip Fast Edge Bead
Mechanically Fixed

— Ventilation angle Wemico 9332 30x(L)mm


1. For information please see Benx Certification Documents.
2. All board joints sealed with RCM Products.

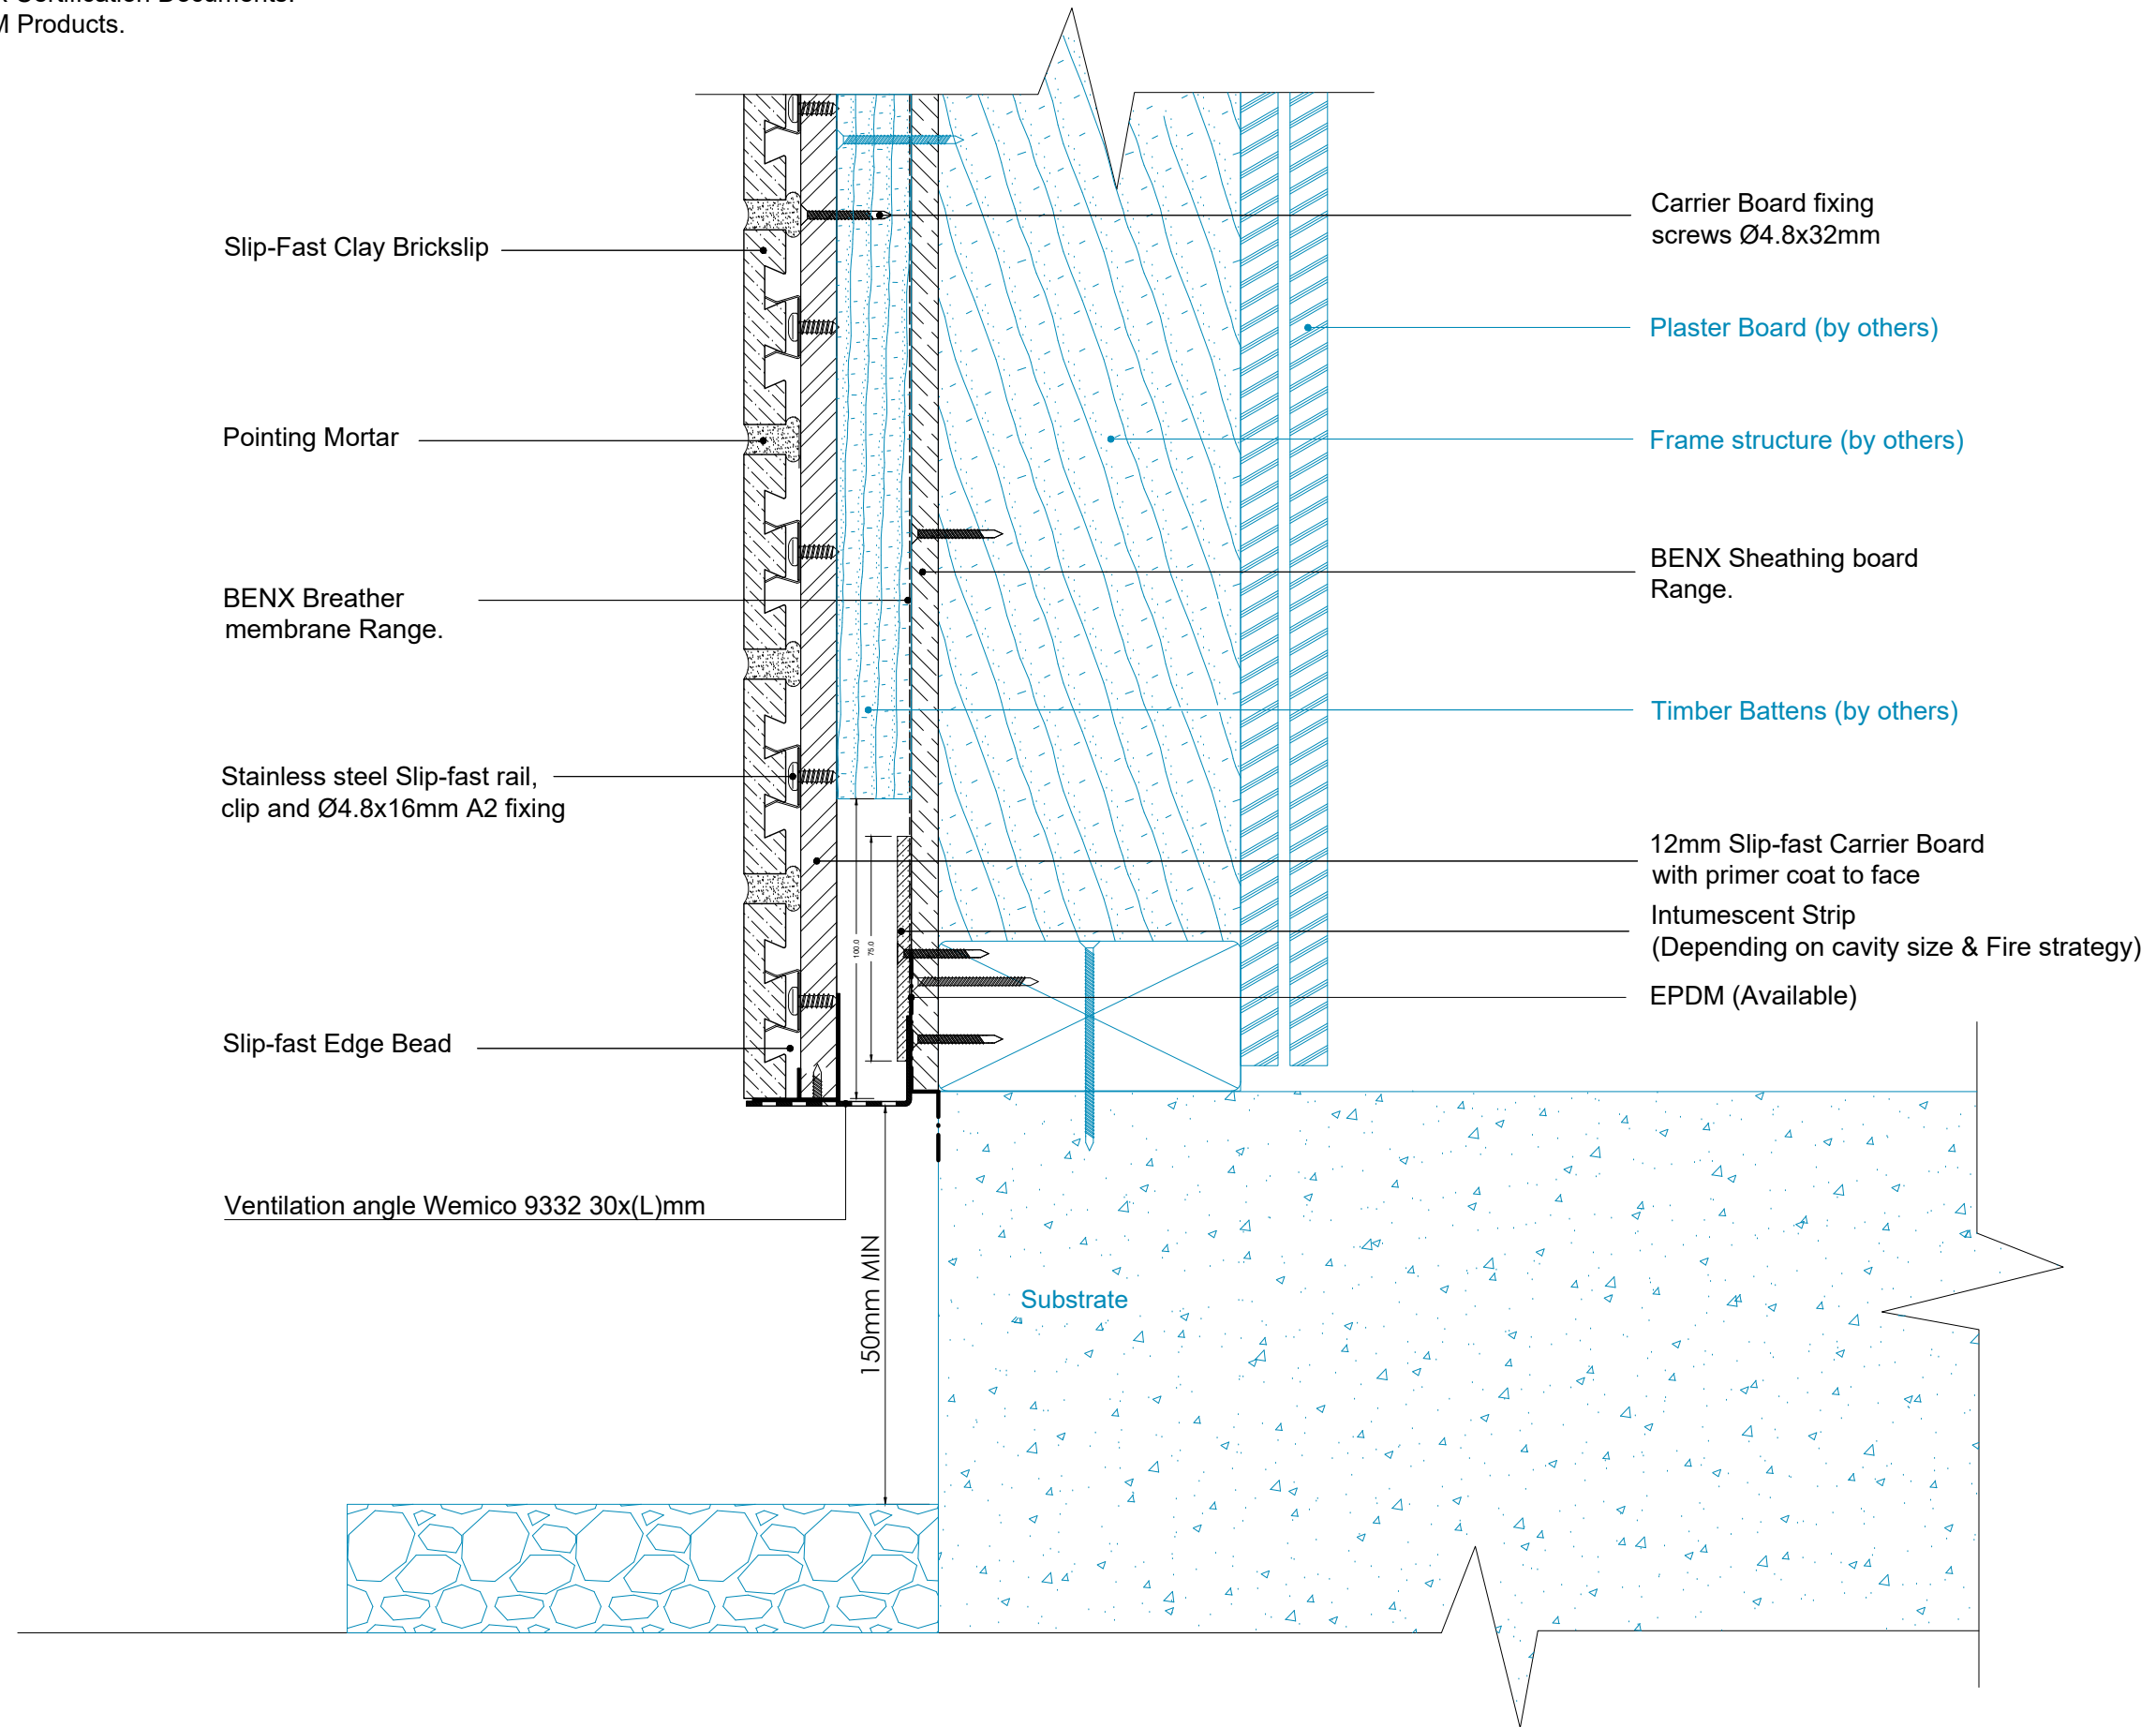

- Note**
- 1. For information please see Benx Certification Documents.
 - 2. All board joints sealed with RCM Products.

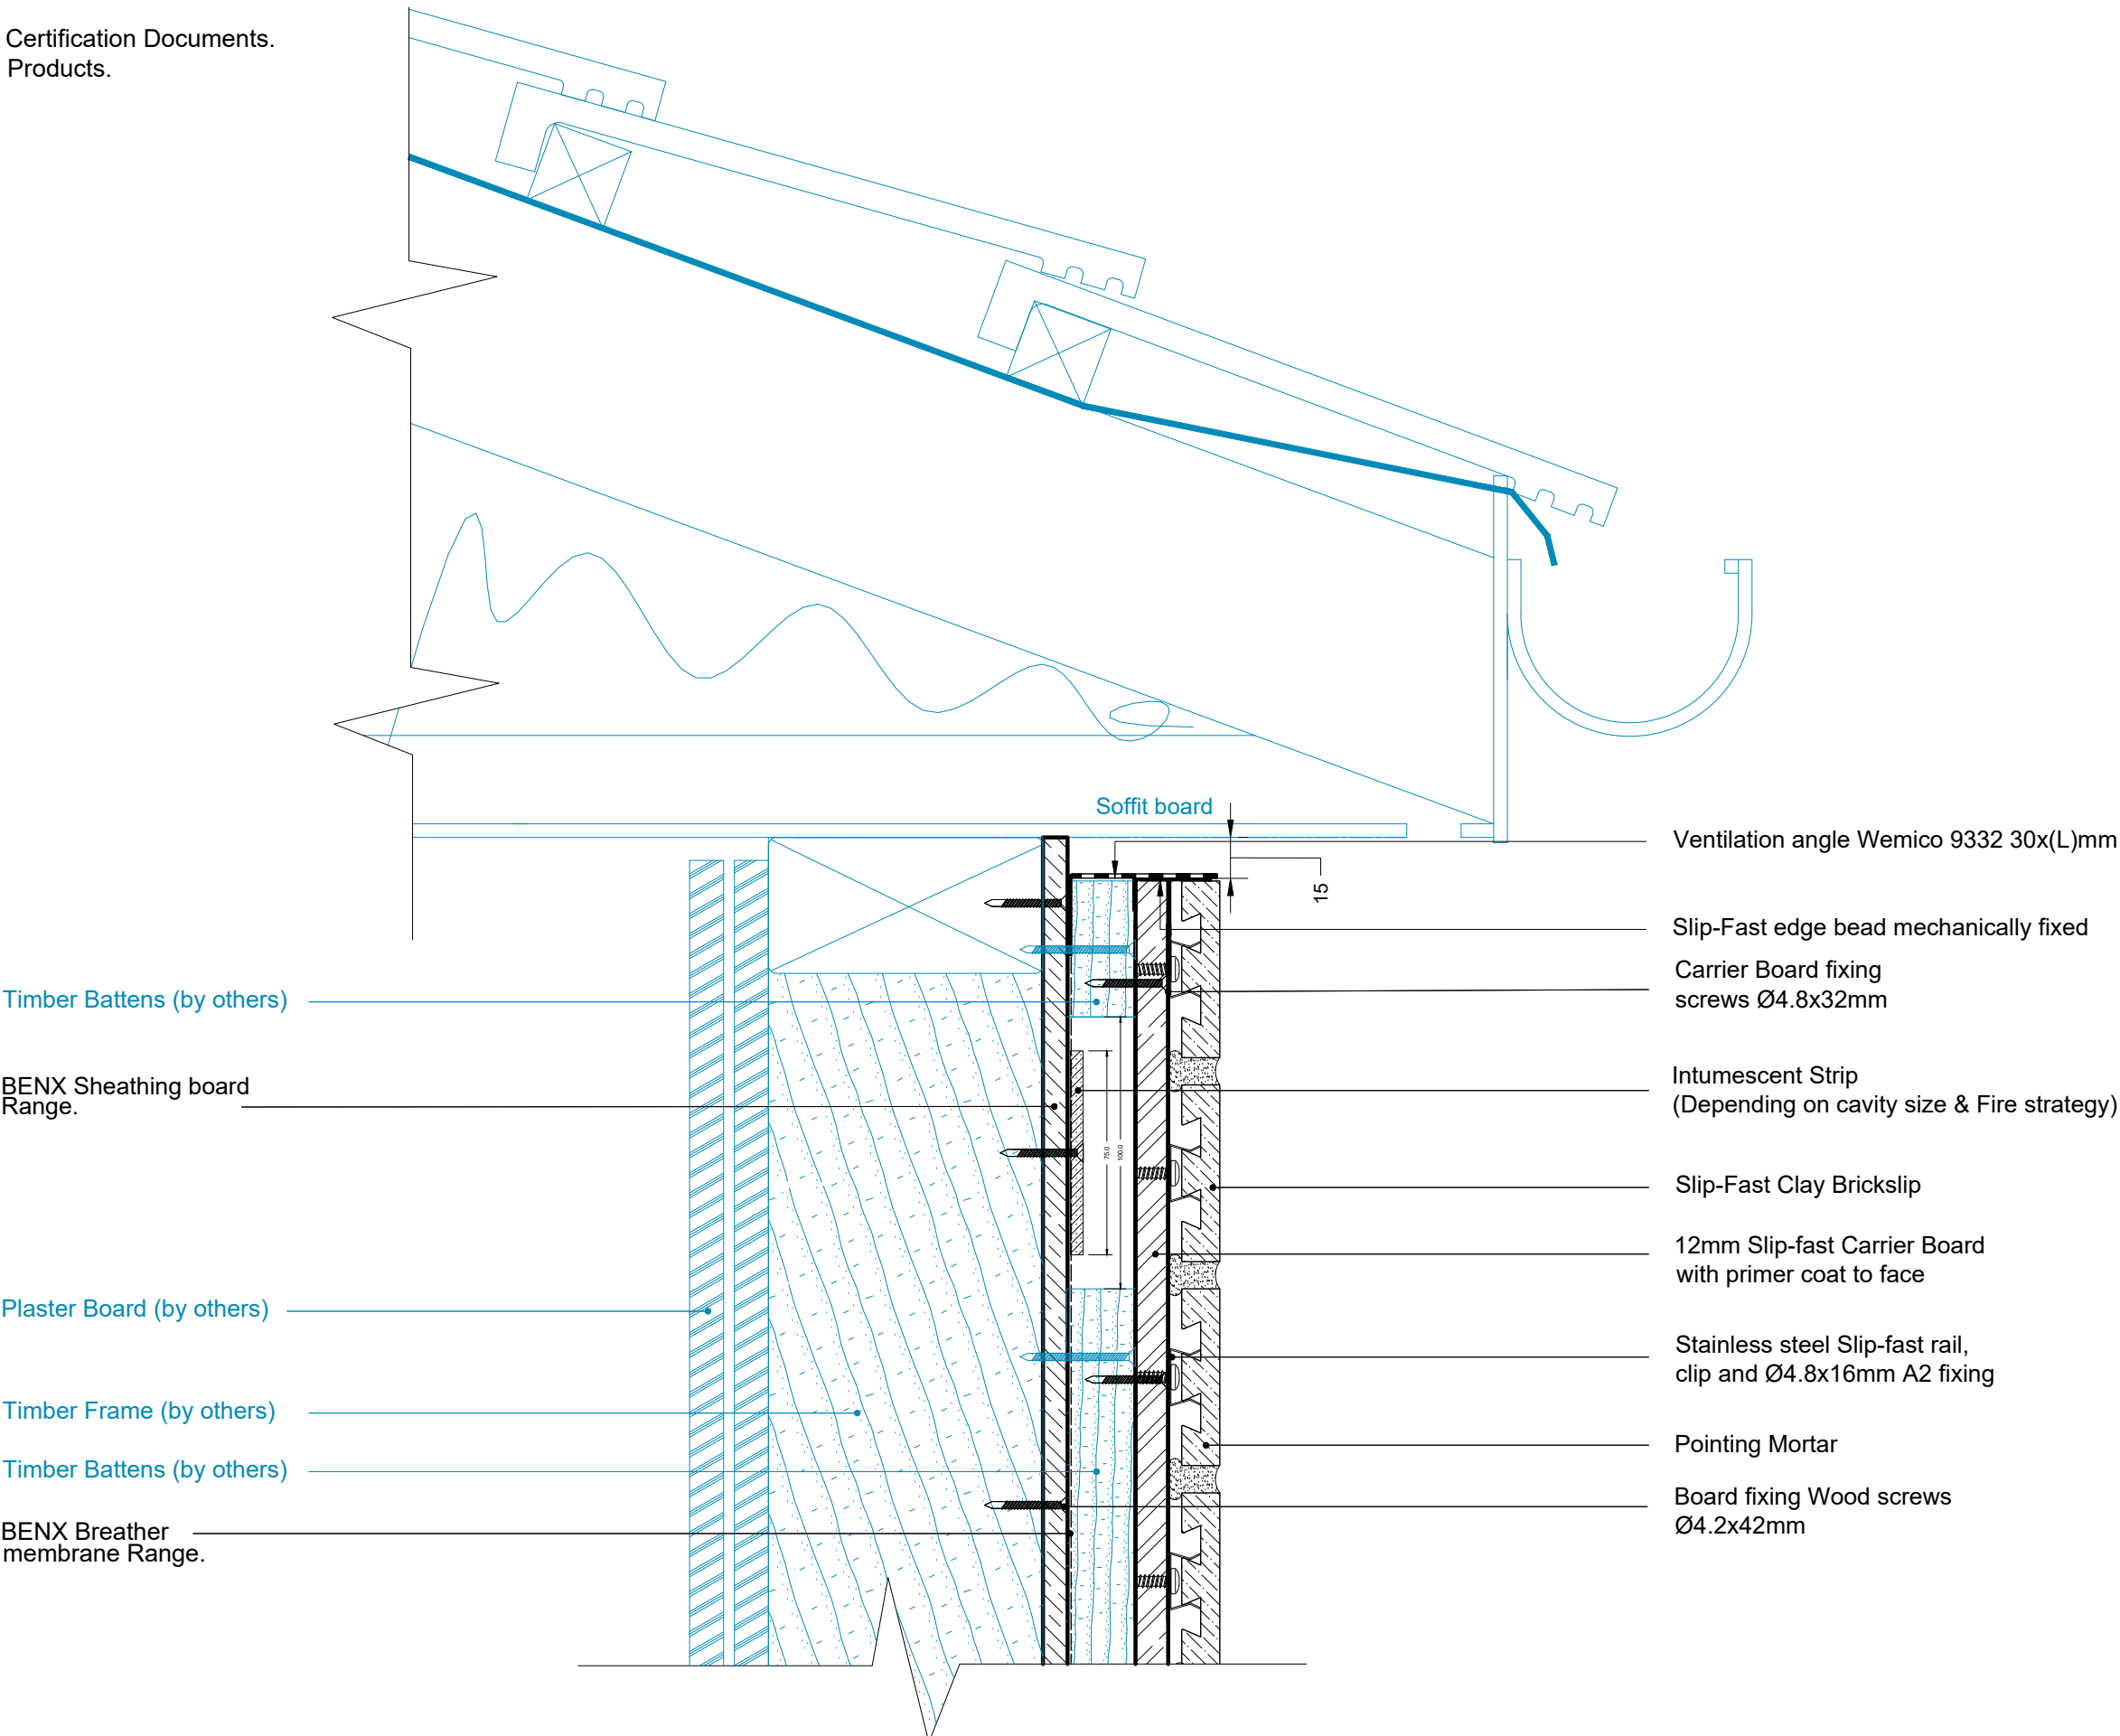


- Note**
- 1. For information please see Benx Certification Documents.
 - 2. All board joints sealed with RCM Products.

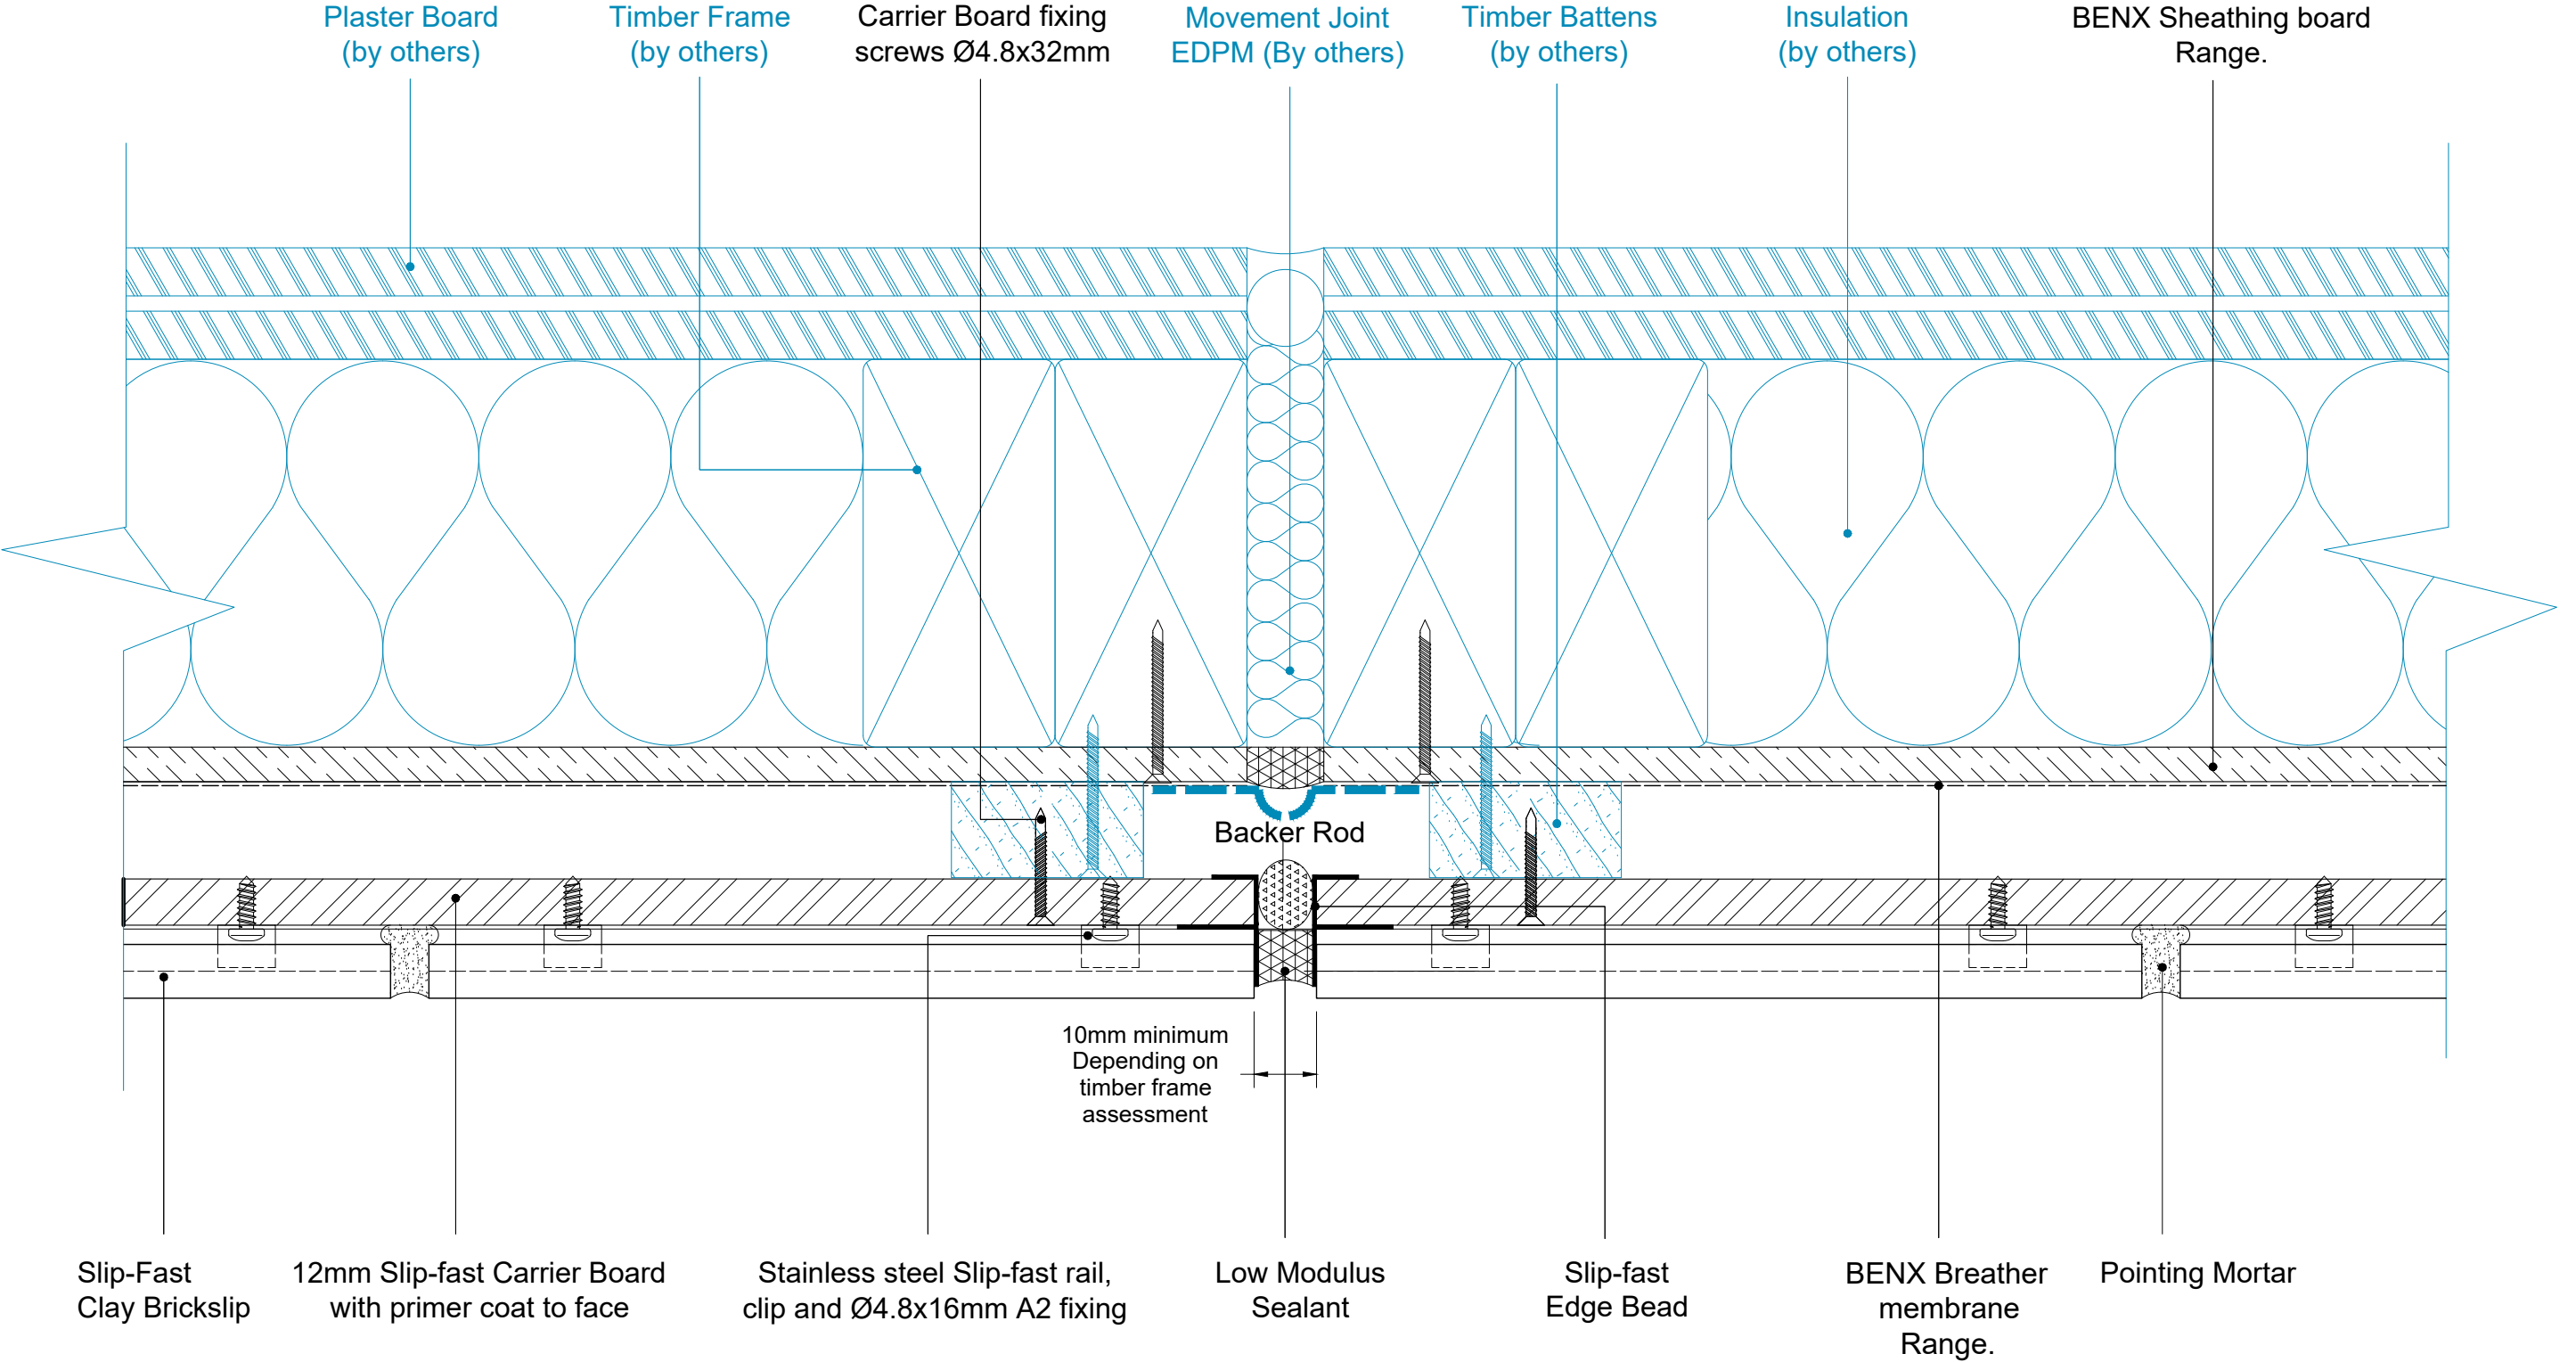


REV	DATE	NOTE	BY	STATUS:	INFORMATION	DRAWN:
A	15/04/23	First Issue	AG	PROJECT:	Slipfast-Brickslip Rainscreen System	AG
B	21/02/24	Text and fixing information updated	AG	ISO No:	5806	MT
				DRAWING No:	5806-TD-SF-TB-TF-BS-0.10	NTS@A3
				DESCRIPTION:	MOVEMENT JOINT VERTICAL	DATE:
						Apr 23
						REV:
						B

- Note**
- 1. For information please see Benx Certification Documents.
 - 2. All board joints sealed with RCM Products.

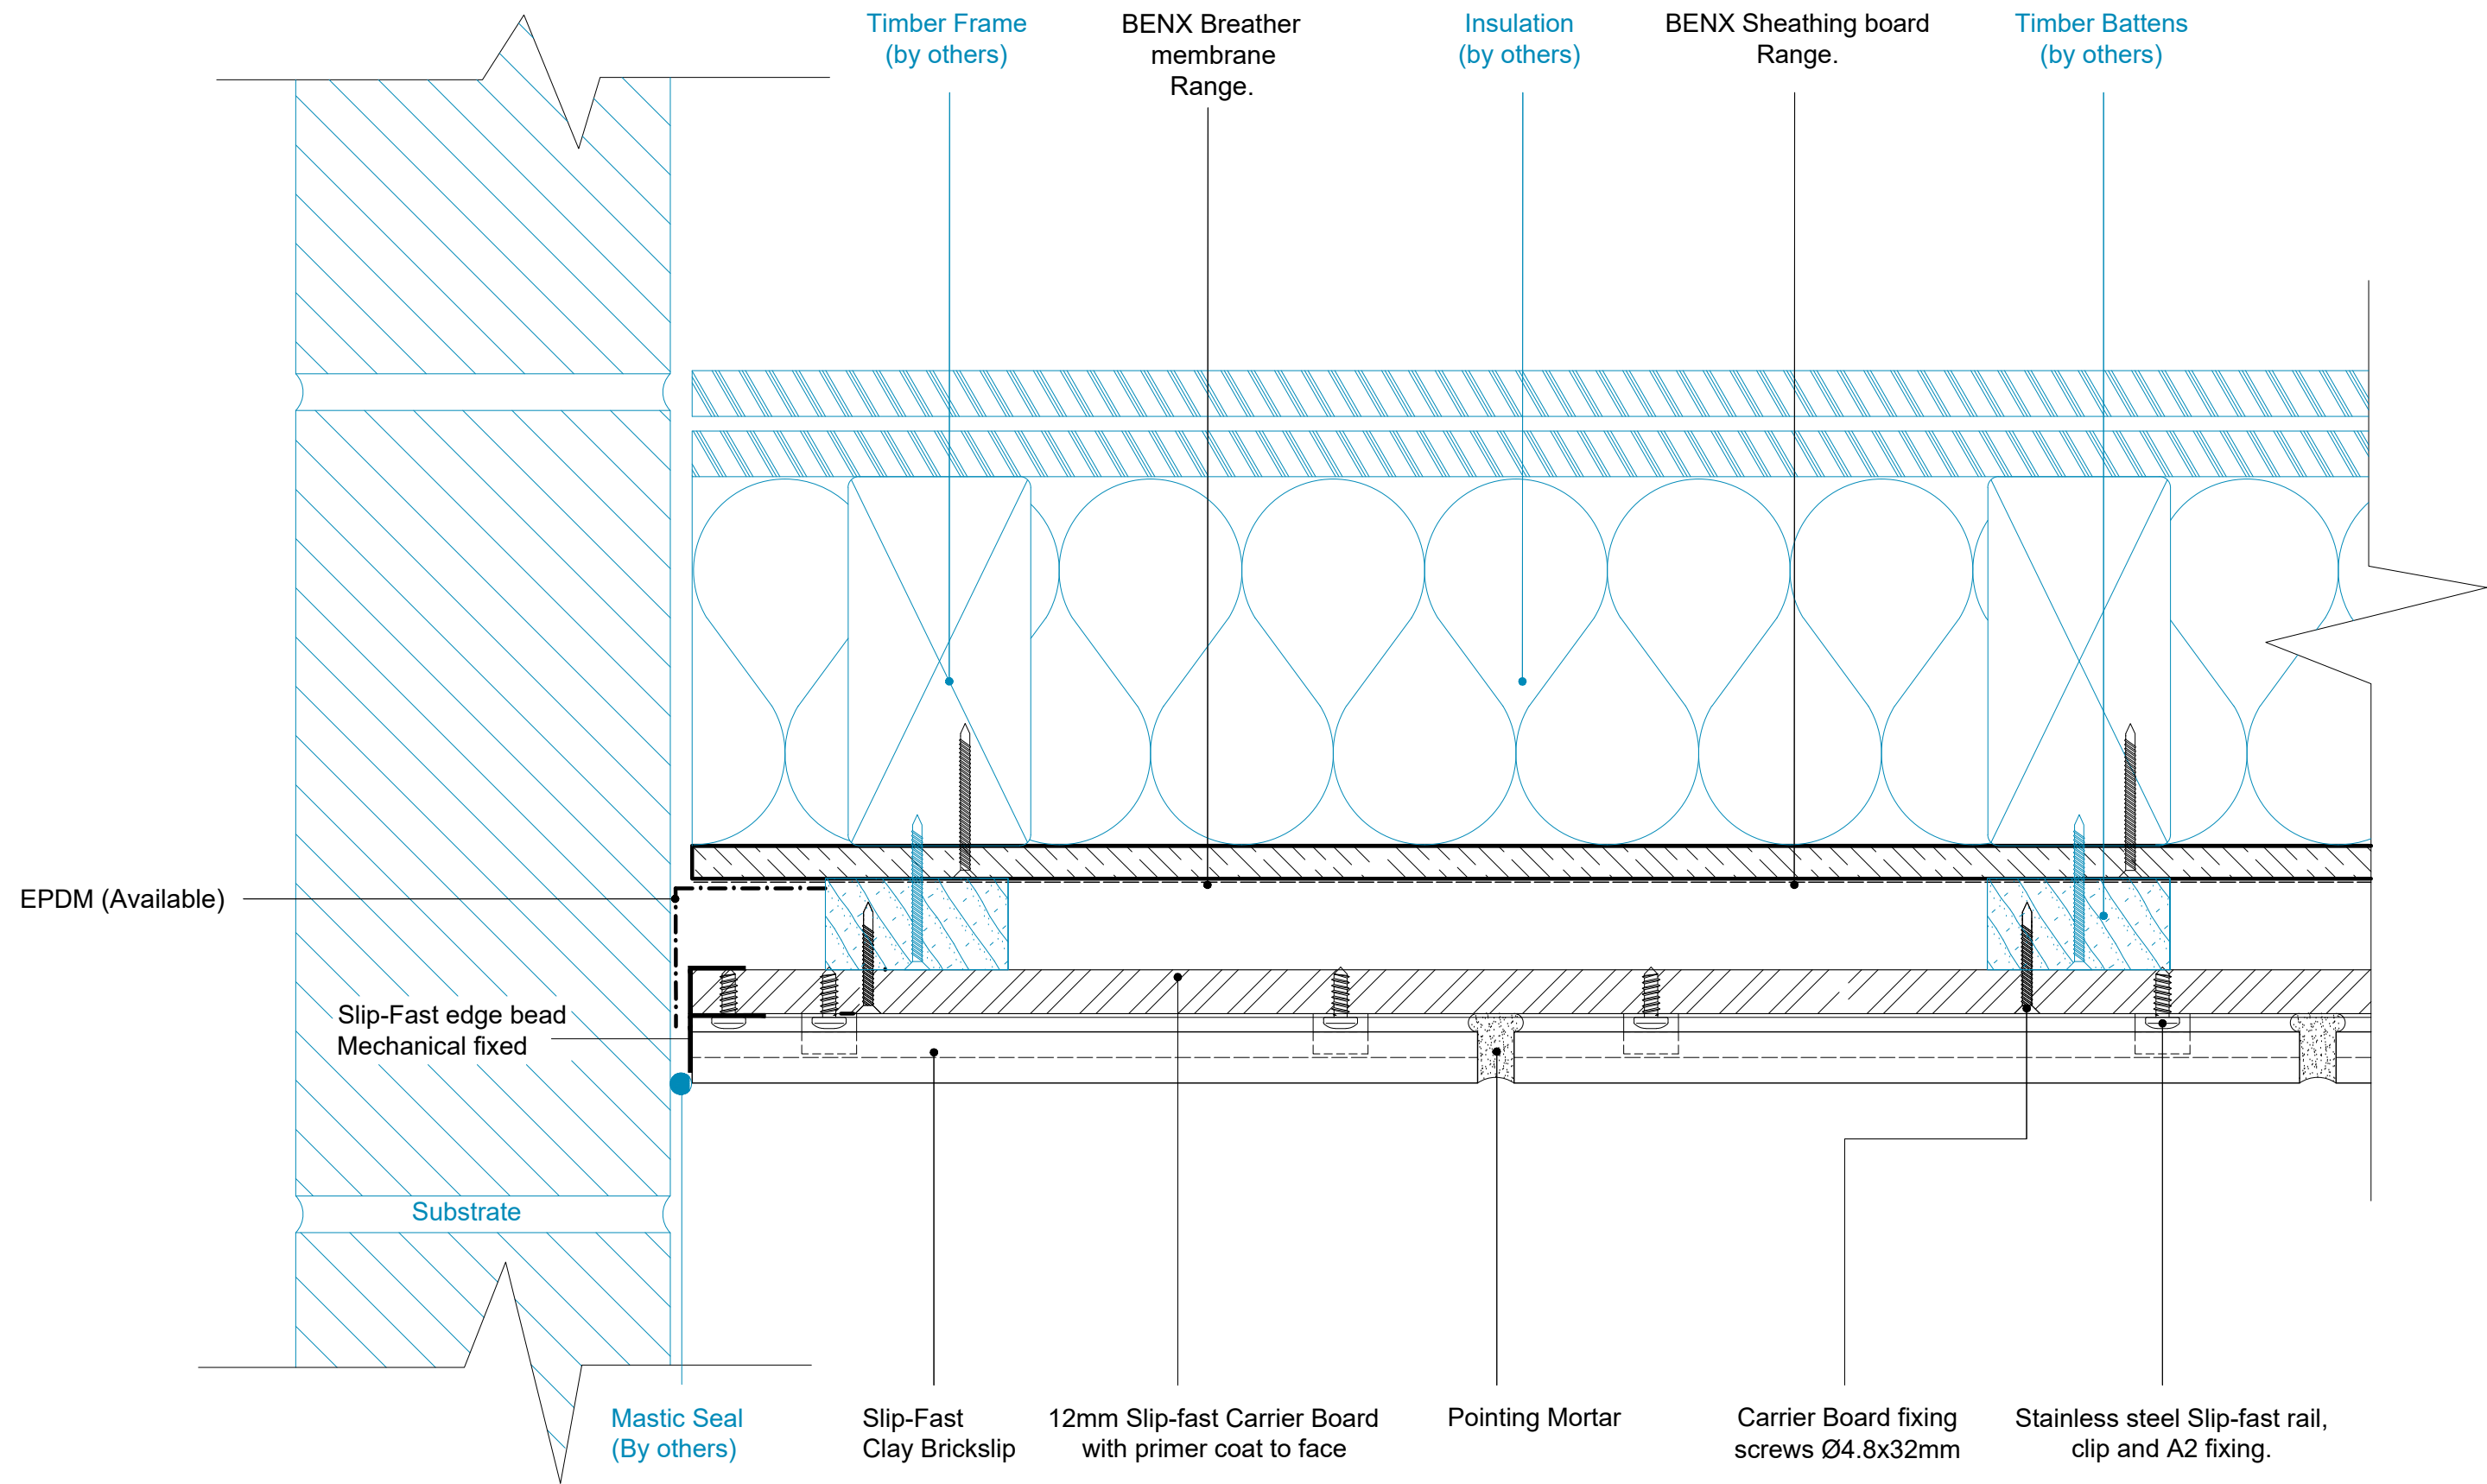

- Note**
- 1. For information please see Benx Certification Documents.
 - 2. All board joints sealed with RCM Products.

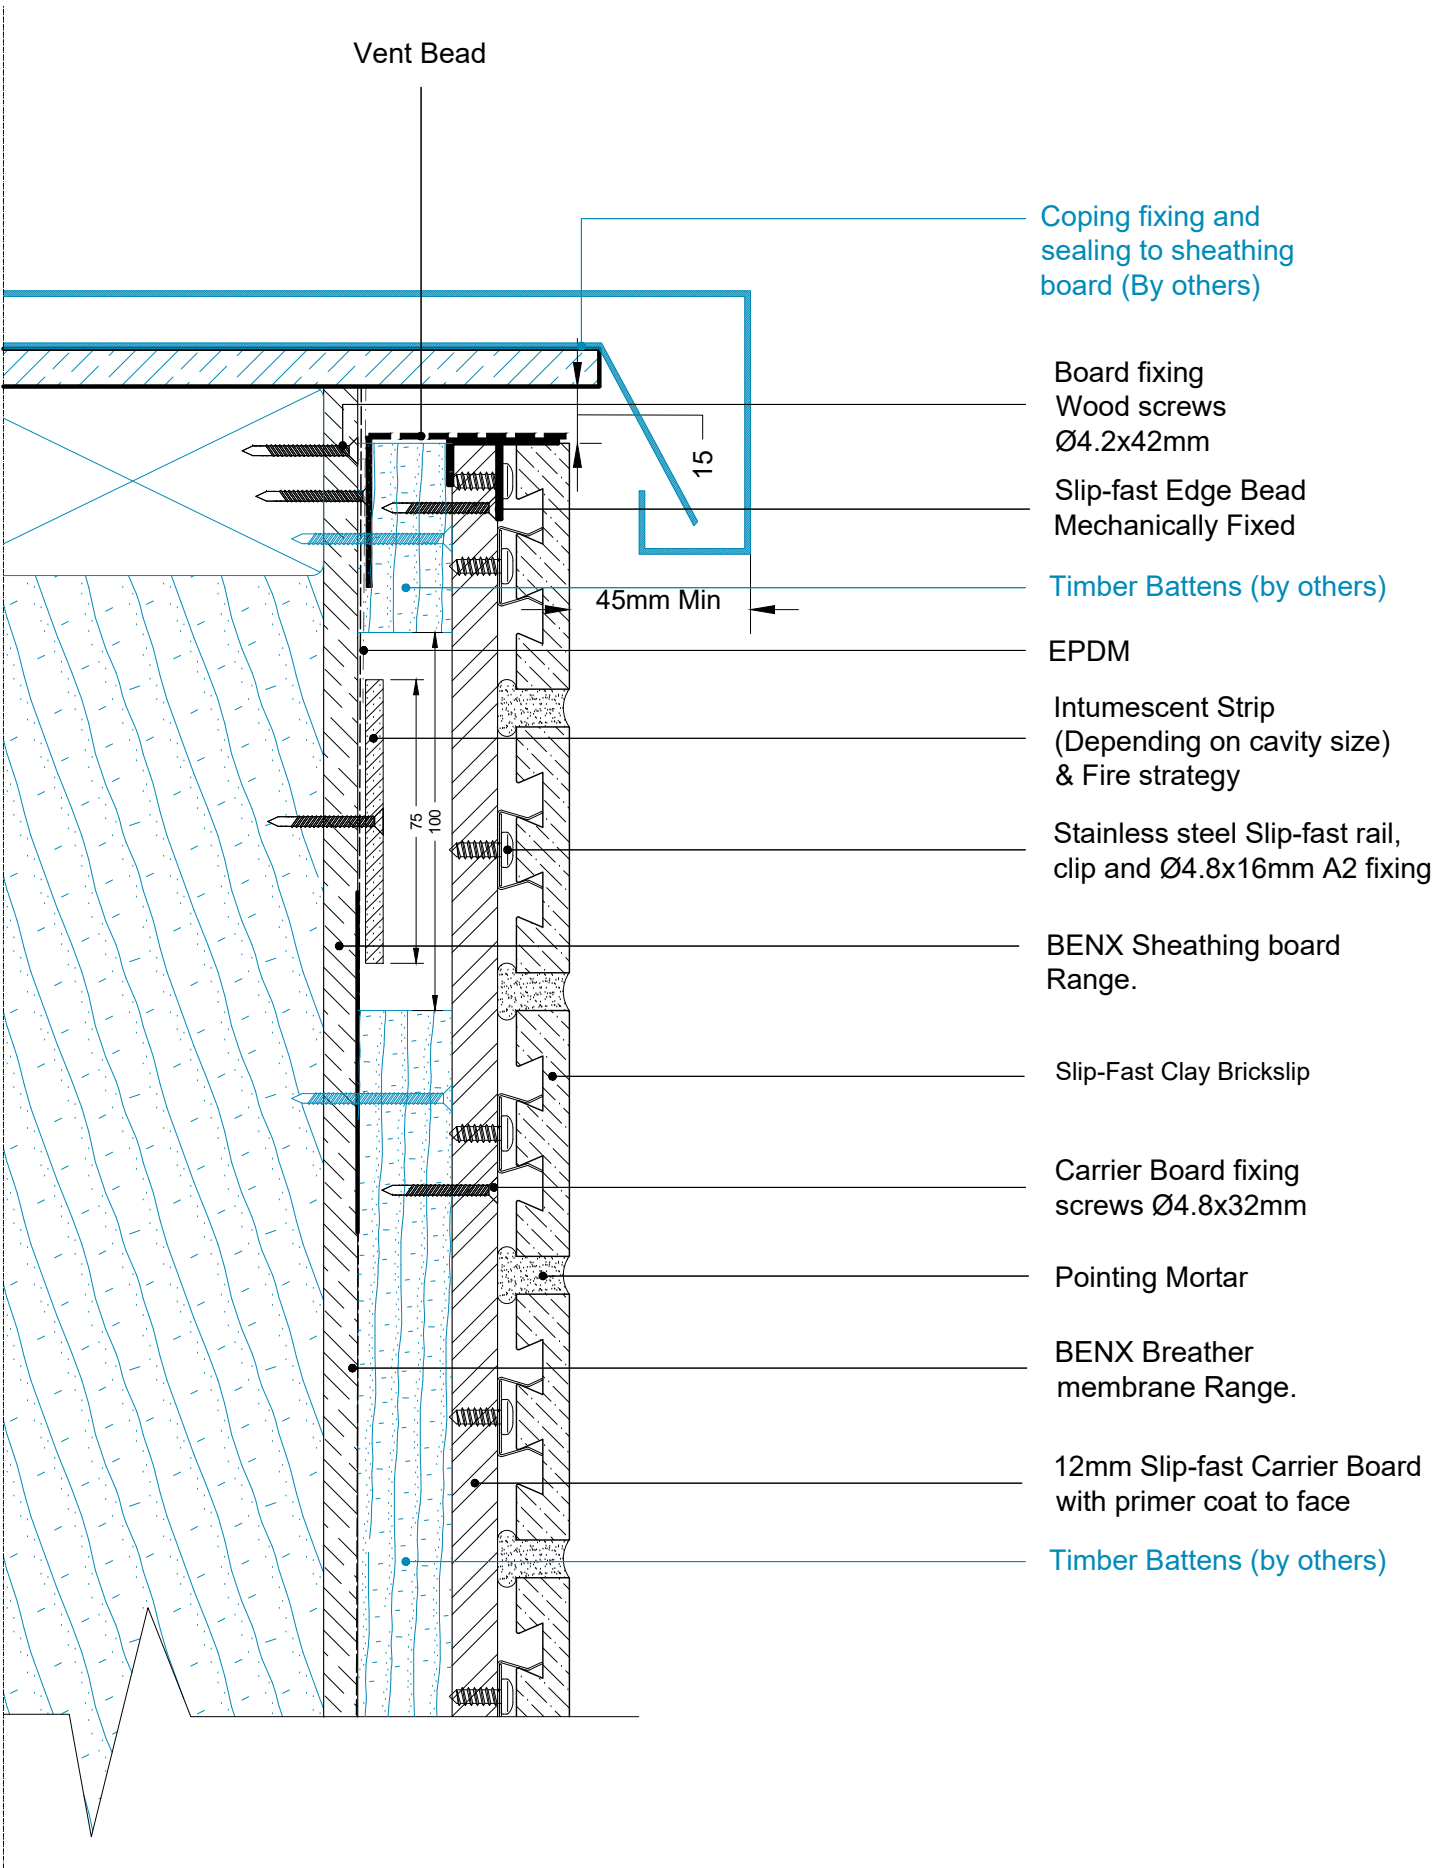


REV	DATE	NOTE	BY	STATUS:	AG	AG	INFORMATION	DRAWN:
A	15/04/23	First Issue	AG	PROJECT:	AG	AG	Slipfast-Bricksip Rainscreen System	AG
B	21/02/24	Text and fixing information updated	AG	ISO No: 5806	AG	AG	MT	MT
				DRAWING No: 5806-TD-SF-TB-TF-BS-0.13			NTS@A3	NTS@A3
				DESCRIPTION:			DATE:	DATE:
				COPING DETAIL			Apr 23	Apr 23
							REV:	REV:
							B	B

1. For information please see Benx Certification Documents.
2. All board joints sealed with RCM Products.




1. For information please see Benx Certification Documents.
2. All board joints sealed with RCM Products.

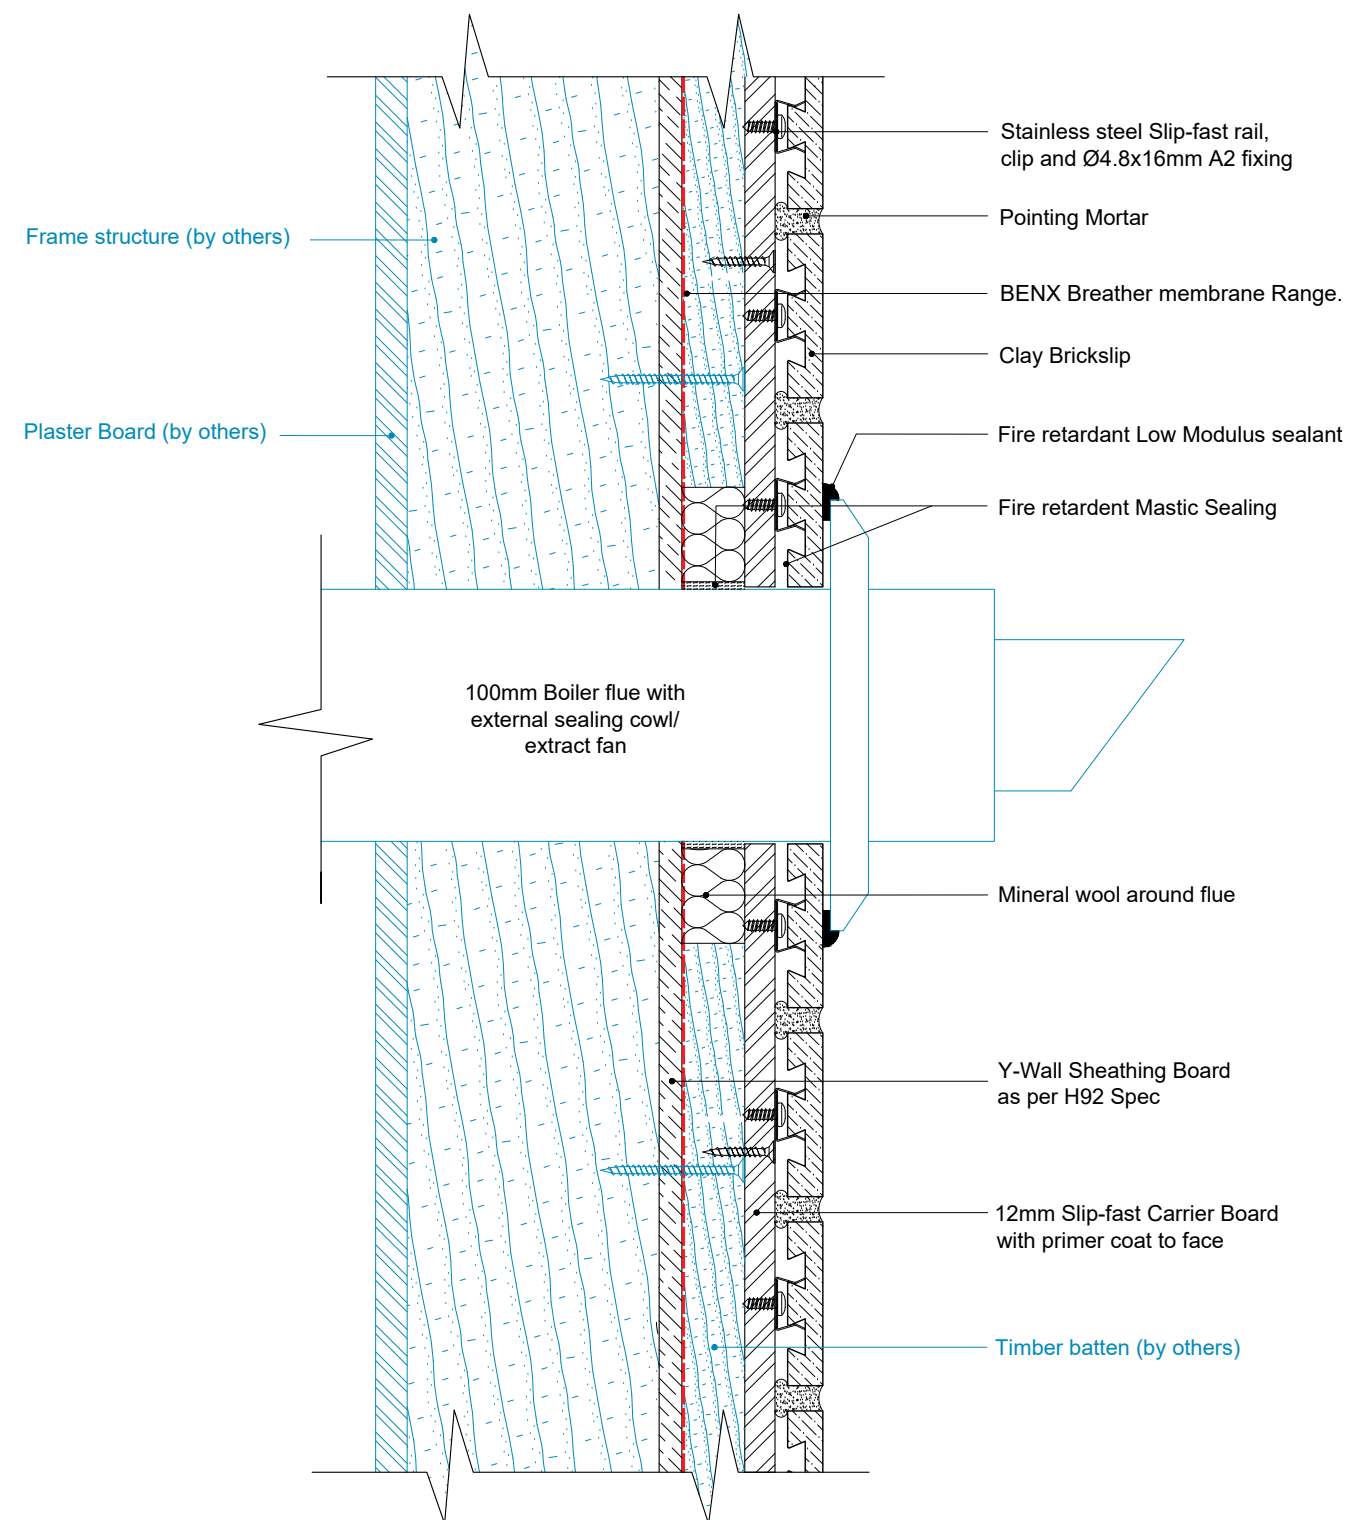

REV	DATE	NOTE	BY	STATUS:	INFORMATION	DRAWN: AG
A B	15/04/23 21/02/24	First Issue Text and fixing information updated	AG AG	PROJECT:	ISO No: 5806	CHECK: MT
				Slipfast-Brickslip Rainscreen System		NTS@a3
				DRAWING No: 5806-TD-SF-TB-TF-BS-0.15		DATE: Apr 23
				DESCRIPTION: FLUE OR EXTRACT FAN DETAIL		REV: B


Note

- 1. For information please see Benx Certification Documents.
- 2. All board joints sealed with RCM Products.

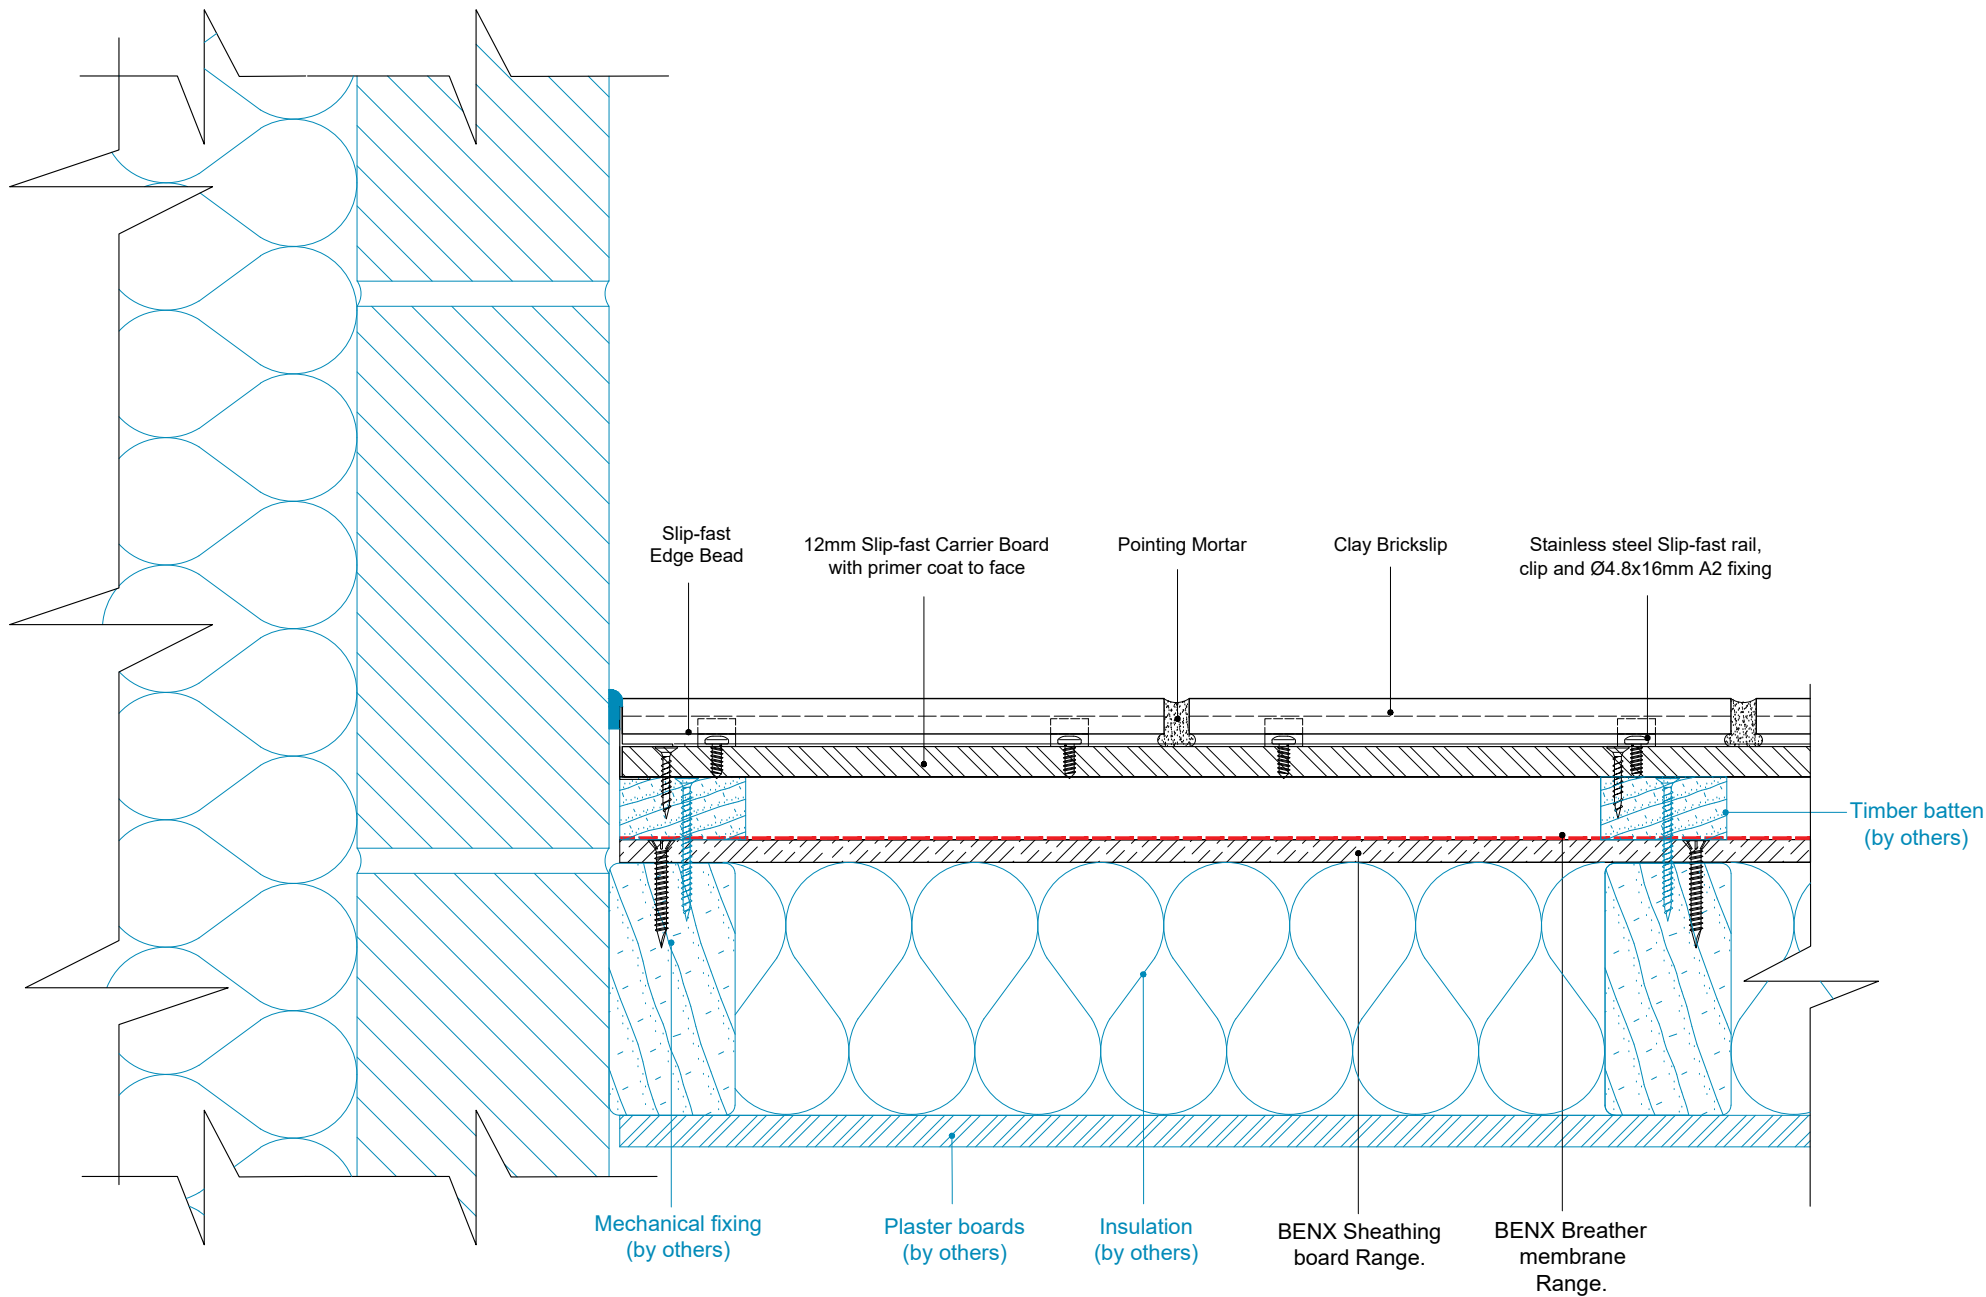


REV	DATE	NOTE	BY	STATUS:	INFORMATION	DRAWN:
A	15/04/23	First Issue	AG	PROJECT:	Slipfast-Brickslip Rainscreen System	AG
B	21/02/24	Text and fixing information updated	AG	ISO No:	5806	MT
				DRAWING No:	5806-TD-SF-TB-TF-BS-0.16	NTS@A3
				DESCRIPTION:	BRICKWORK ABUTMENT JOINT DETAIL	DATE:
						Apr 23
						REV:
						B

- Note**
- 1. For information please see Benx Certification Documents.
 - 2. All board joints sealed with RCM Products.

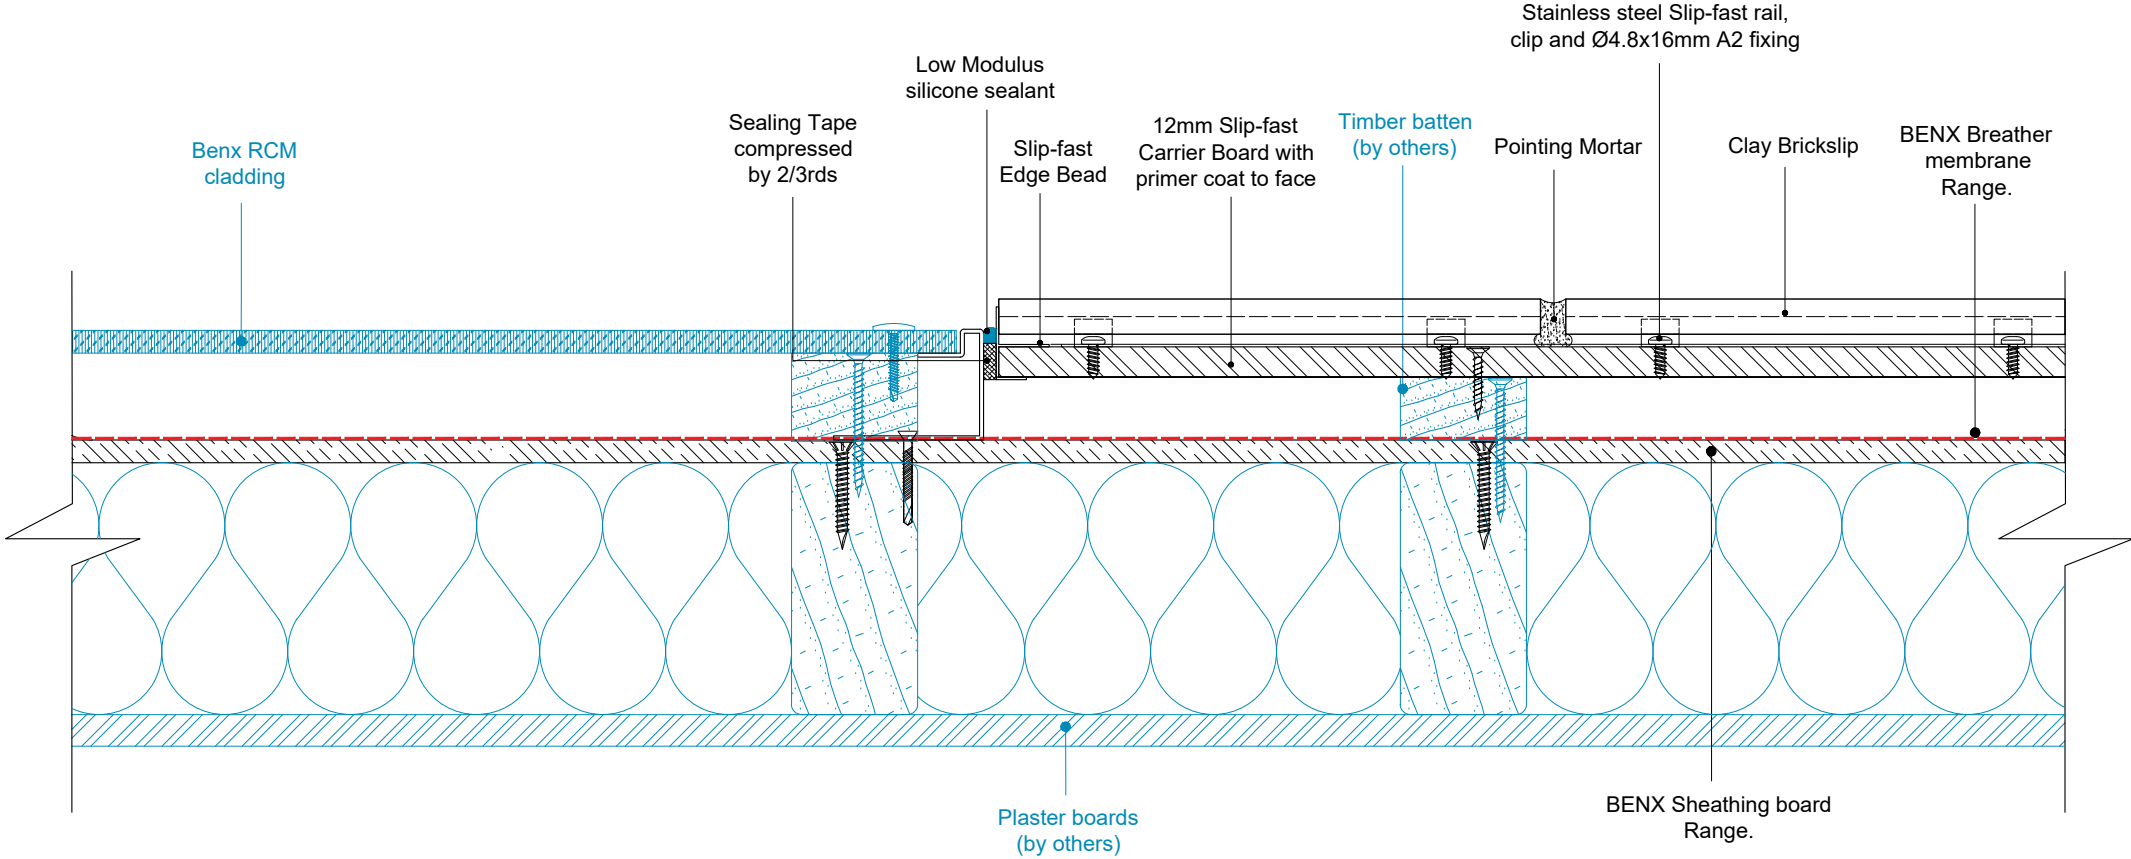


REV	DATE	NOTE	BY	STATUS:	INFORMATION	DRAWN:
A	15/04/23	First Issue	AG	PROJECT:	Slipfast-Brickslip Rainscreen System	AG
B	21/02/24	Text and fixing information updated	AG	ISO No:	5806	MT
				DRAWING No:	5806-TD-SF-TB-TF-BS-0.17	NTS@A3
				DESCRIPTION:	JOINT WITH OTHER CLADDING SYSTEM DETAIL	DATE:
						Apr 23
						REV:
						B

1. For information please see Benx Certification Documents.
2. All board joints sealed with RCM Products.

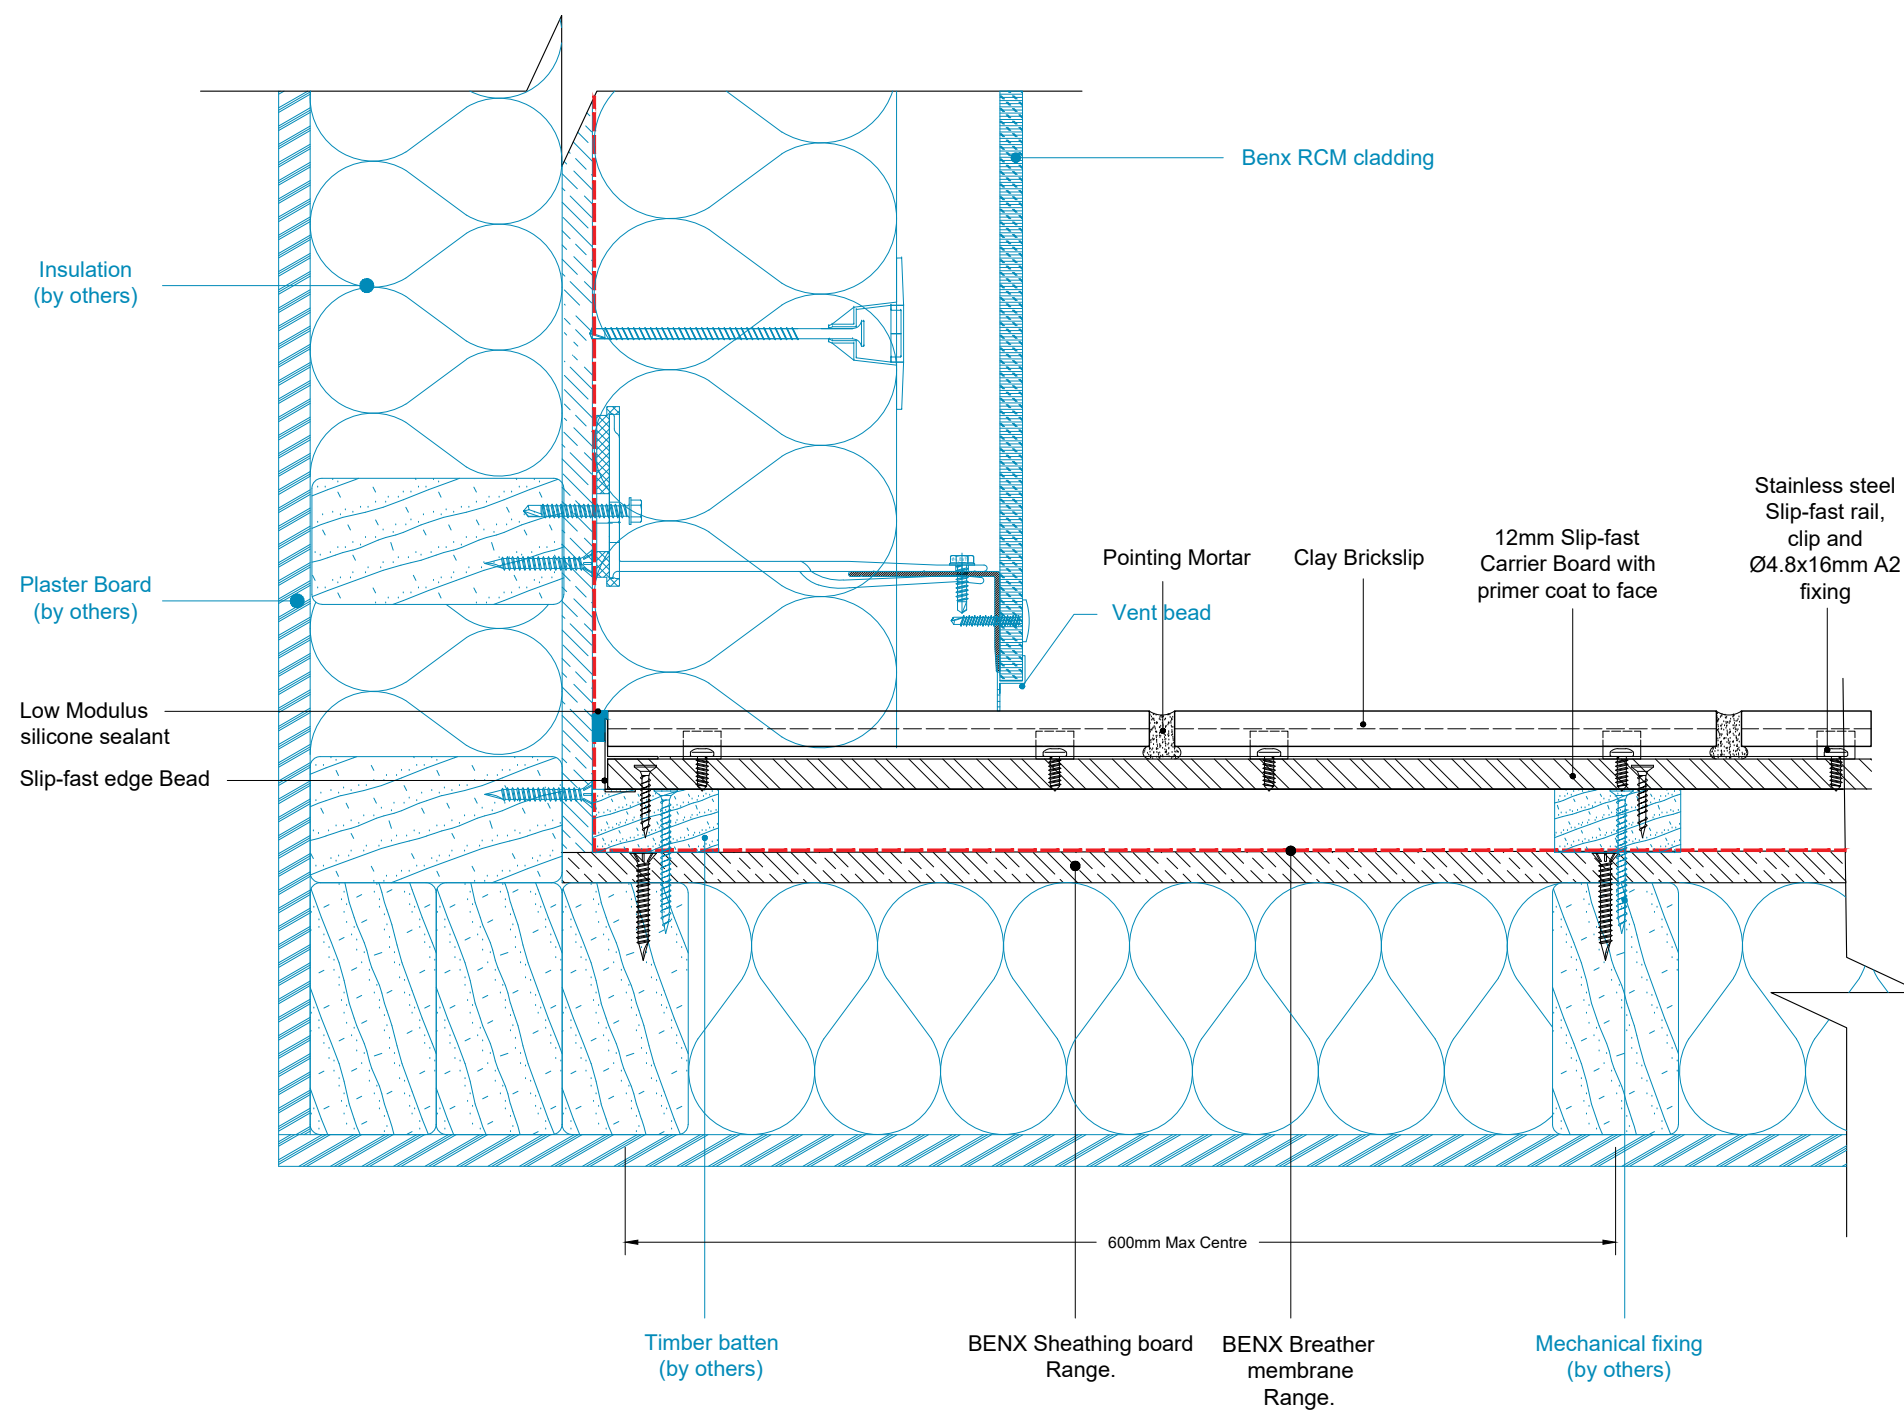


- Note**
- 1. For information please see Benx Certification Documents.
 - 2. All board joints sealed with RCM Products.

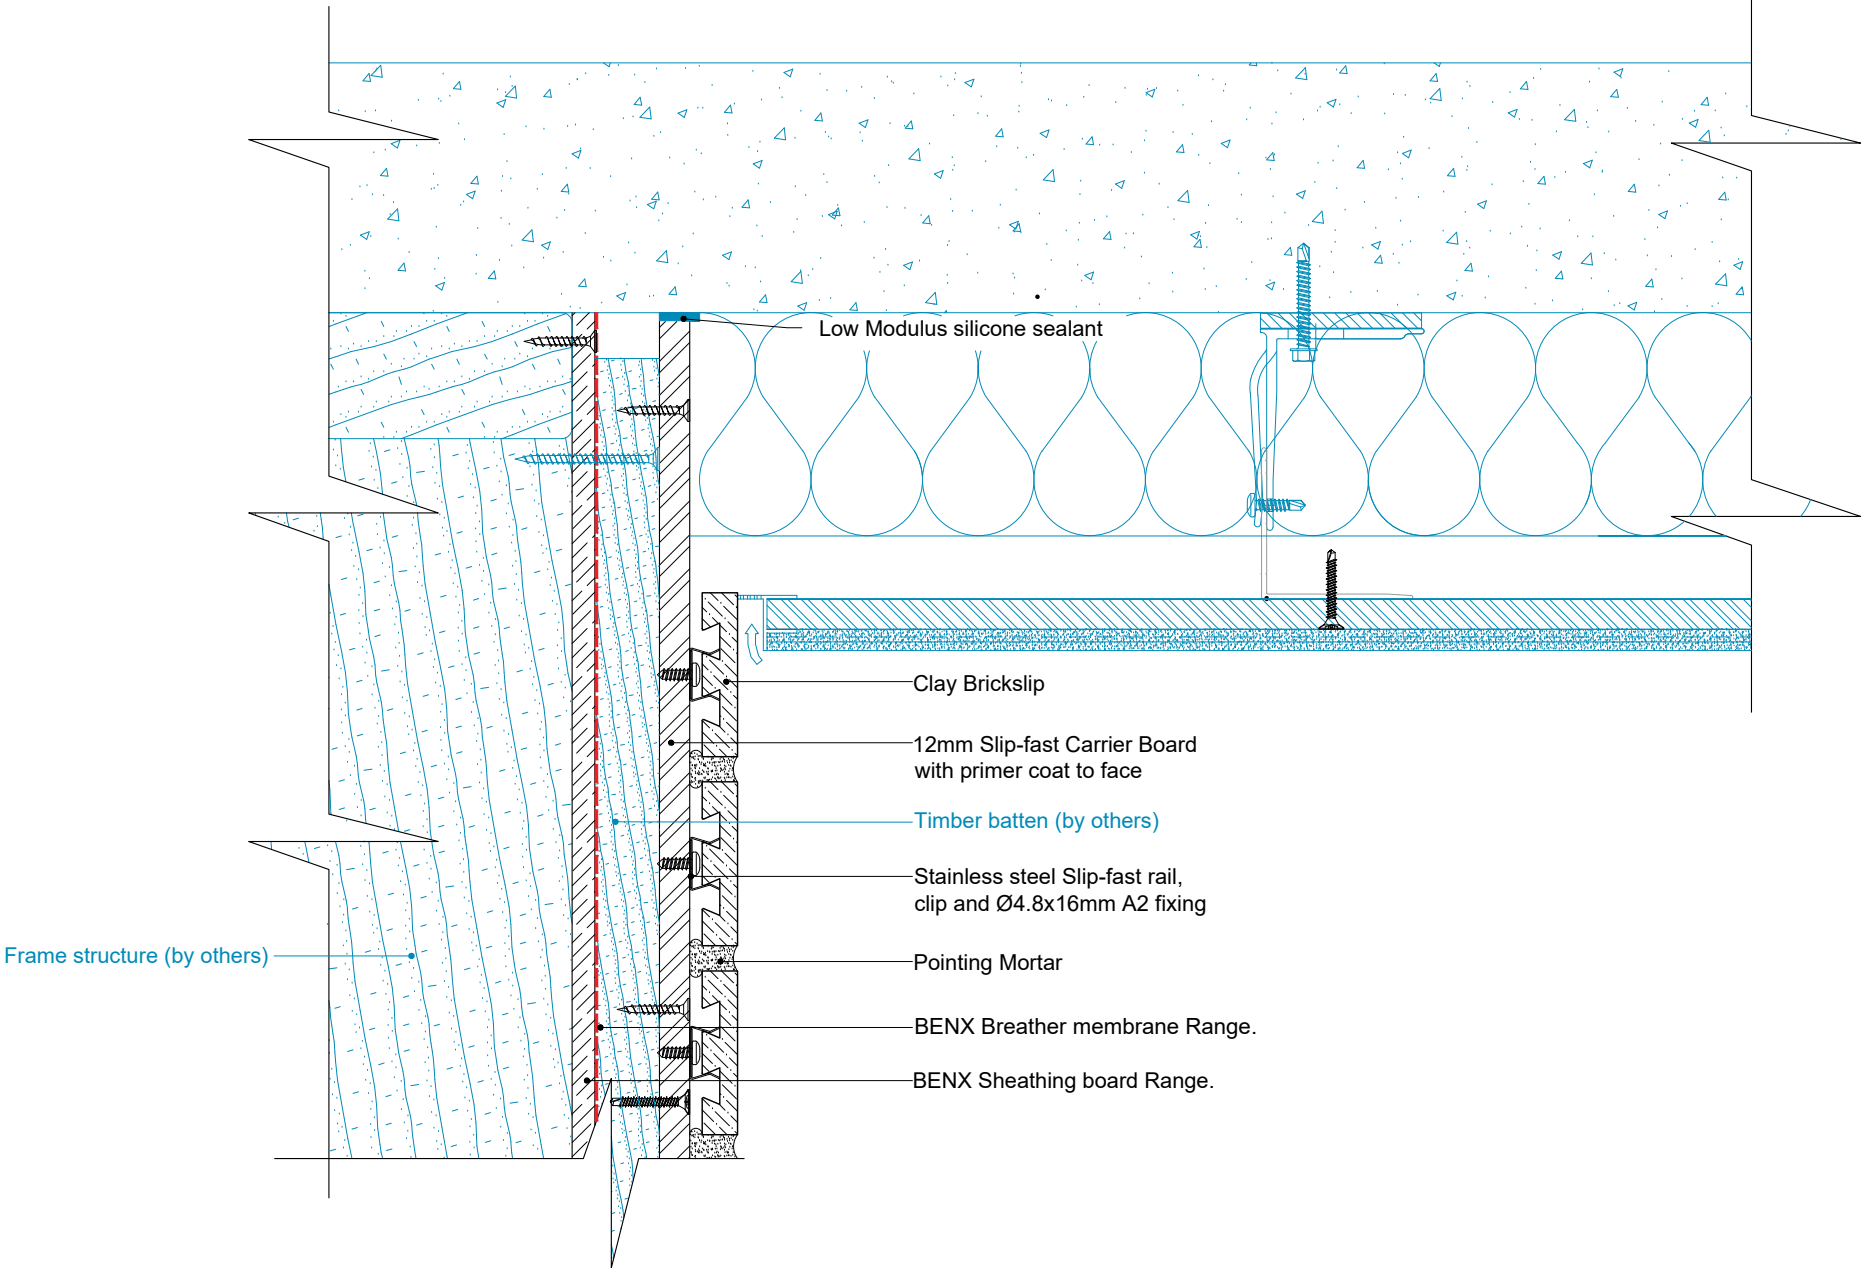

REV	DATE	NOTE	BY	STATUS:	INFORMATION	DRAWN:
A	15/04/23	First Issue	AG	PROJECT:	Slipfast-Brickslip Rainscreen System	AG
B	21/02/24	Text and fixing information updated	AG	ISO No:	5806	MT
				DRAWING No:	5806-TD-SF-TB-TF-BS-0.19	NTS@A3
				DESCRIPTION:	SUSPENDED SOFFIT DETAIL	DATE:
						Apr 23
						REV:
						B

1. For information please see Benx Certification Documents.
2. All board joints sealed with RCM Products.

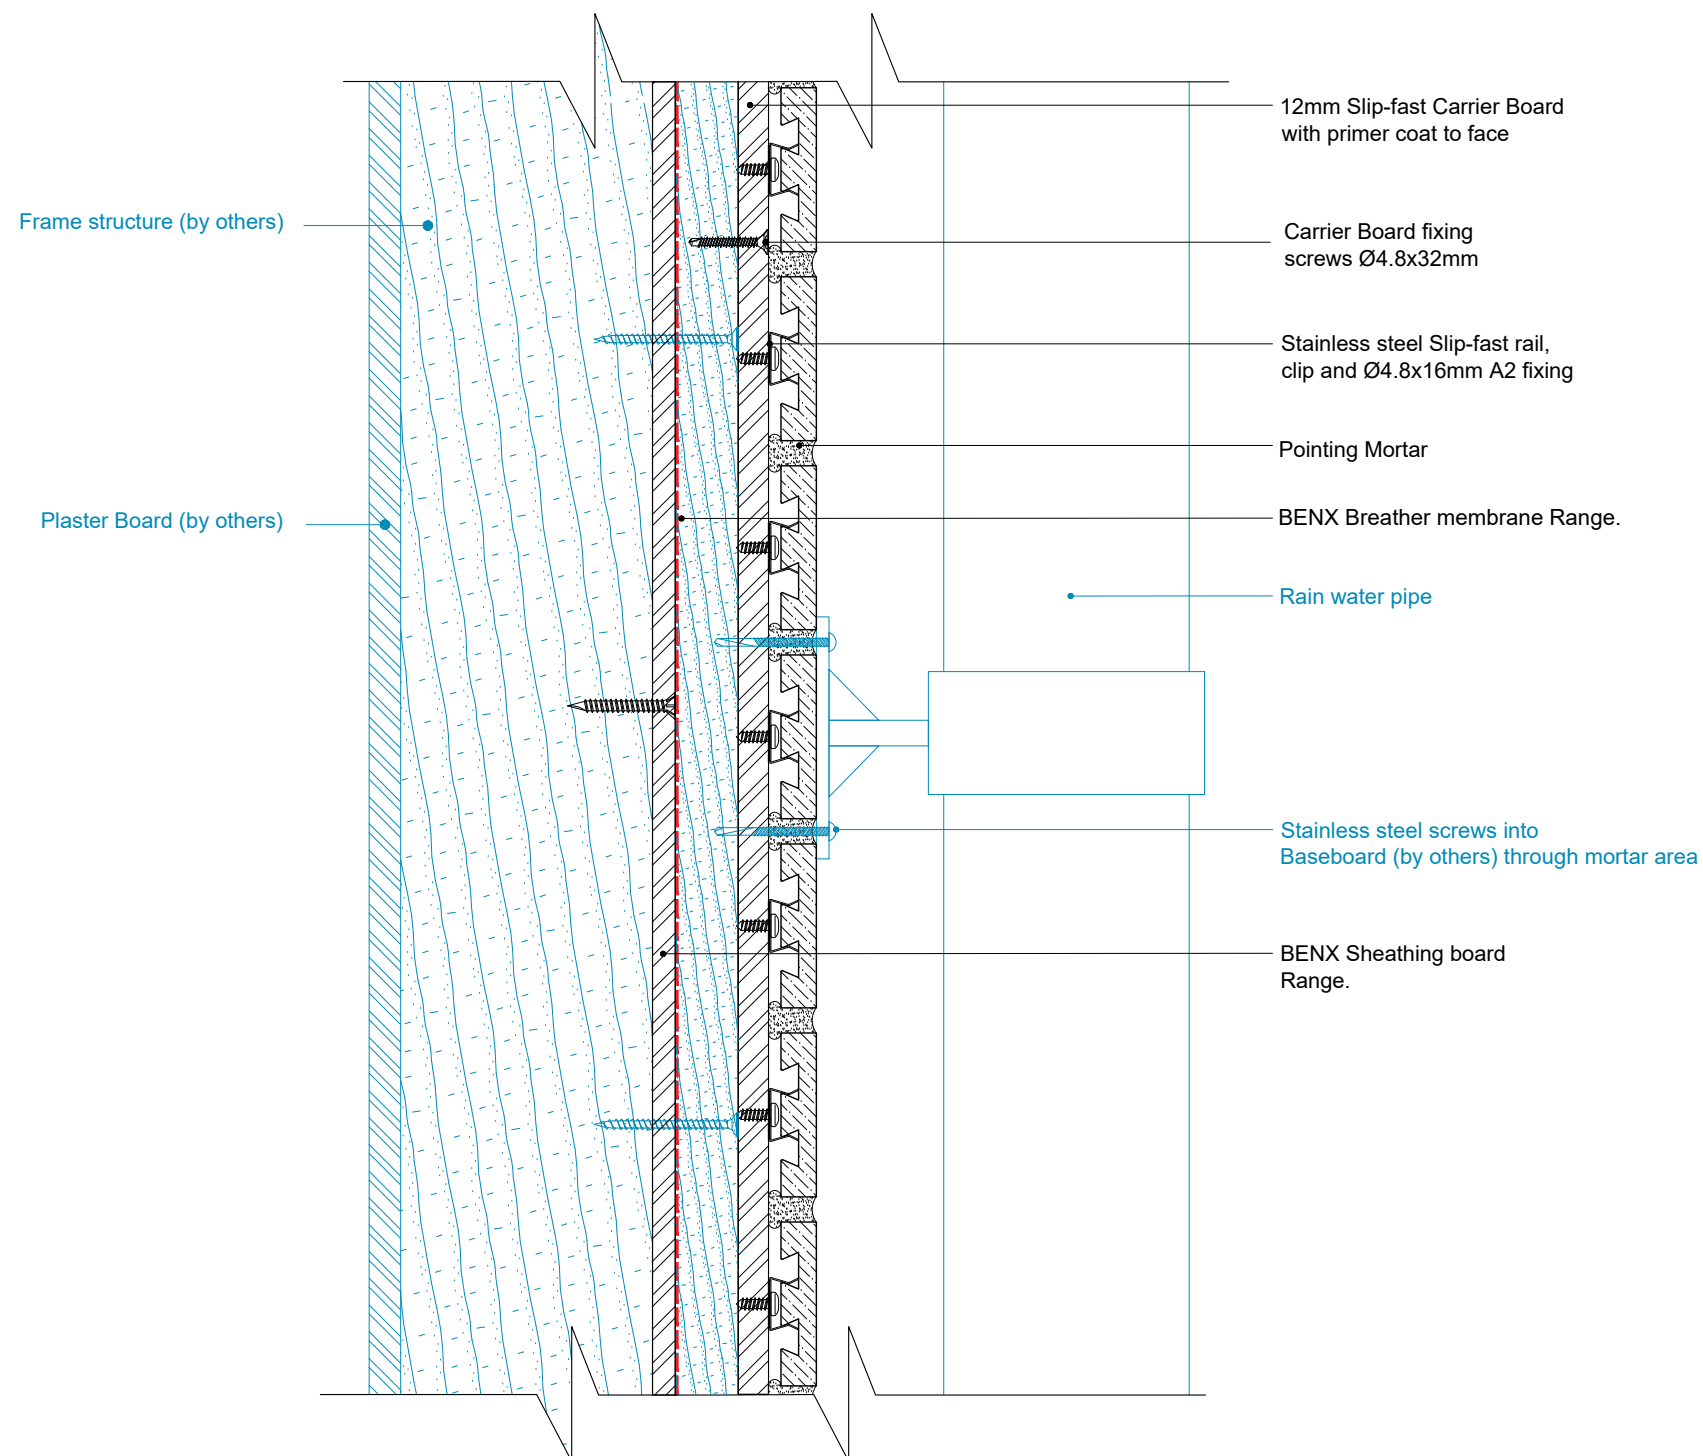

1. For information please see Benx Certification Documents.
2. All board joints sealed with RCM Products.



All performance data & systems specifications are for systems constructed with materials & components as shown. The inclusion or substitution of any other manufactures materials or components invalidates both test data, system performance and compliance with CDM 2015. The information is provided and based upon details received, which are assumed to include all the relevant facts and data. While it is believed to be correct, we accept no liability for its accuracy, adequacy or completeness. Recipients must satisfy themselves as to its suitability as we do not accept responsibility for any claims or consequential loss. Acceptance of the content and subsequent design responsibility rests entirely with the recipients. Any subsequent design changes that affect the detail which is contained in a written form will void this detail. The use of the content may be copied without the prior approval from the Benx Group Technical Services Department. This statement should be read in conjunction with the standard terms and conditions of Benx Group.

REV	DATE	NOTE	BY	STATUS:	INFORMATION	DRAWN: AG
A B	15/04/23 21/02/24	First Issue Text and fixing information updated	AG AG	PROJECT:	ISO No: 5806	CHECK: MT
				Slipfast-Brickslip Rainscreen System		NTS@a3
				DRAWING No: 5806-TD-SF-TB-TF-BS-0.21		DATE: Apr 23
				DESCRIPTION:		REV:
				EXTERNAL FIXING DETAIL		B